

Single Survey

survey report on:

Property address	2 Moray Street Hopeman Elgin IV30 5SA
Customer	
Customer address	2 Moray Street Hopeman Elgin IV30 5SA
Prepared by	ALLIED SURVEYORS SCOTLAND PLC
Date of inspection	30th July 2021

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise an ex Local Authority two storey semi-detached House.
Accommodation	Ground Floor - Hallway and Stairs, Lounge, Kitchen. First Floor - Landing, 2 Bedrooms, Bathroom.
Gross internal floor area (m²)	70m ² .
Neighbourhood and location	The property is situated in an area of Local Authority housing within the coastal village of Hopeman, convenient for local amenities. More extensive facilities are available in nearby Elgin and Lossiemouth.
Age	Approximately 56 years.
Weather	Overcast but dry. The report should be within the context of these weather conditions.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. There is a single mutual stack of rendered block construction and having lead flashings!
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Single Survey

	<p>Pitched, timber framed and clad with concrete tiles. Internally the loft space was partially floored and limited insulation has been installed at ceiling joist level. The hot water cylinder is located in the roof space.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>PVC manufacture.</p>
Main walls	<p>Visually inspected with the aid of binoculars where appropriate.</p> <p>Foundations and concealed parts were not exposed or inspected.</p> <p>The walls are of concrete block cavity construction, rendered externally and incorporating sub-floor ventilation. It would appear that cavity wall insulation has been installed. I have, however, not had any sight of documentation relating to this.</p>
Windows, external doors and joinery	<p>Internal and external doors were opened and closed where keys were available.</p> <p>Random windows were opened and closed where possible.</p> <p>Doors and windows were not forced open.</p> <p>The windows are of uPVC double glazed design. Doors are of hardwood single glazed design. Fascias would appear to be formed in softwood. Soffits are formed in either ply or asbestos cement sheet.</p>
External decorations	<p>Visually inspected.</p> <p>External woodwork has either been painted or stained.</p>
Conservatories / porches	<p>None.</p>
Communal areas	<p>None.</p>
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>There is a semi-detached block built Shed with corrugated cement fibre sheet clad roof. No internal access was possible as the door was padlocked.</p>

Single Survey

Outside areas and boundaries	Visually inspected. There are garden grounds to the front, rear and side which are part-bounded by fencing.
Ceilings	Visually inspected from floor level. Plasterboard lined.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Either plastered on the hard or plasterboard lined.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Suspended timber design. My inspection of the flooring was restricted due to fitted floor coverings and furnishings and there was no access possible to any of the sub-floor areas.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Skirtings/architraves are formed in softwood. Doors are of flush hollow panel design. The Kitchen comprises a sink and a range of units.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. There is an open fireplace in the Lounge.
Internal decorations	Visually inspected. Walls and ceilings have been papered or painted. Joinery has been painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply.

Single Survey

	Distribution wiring, where seen, is formed in PVC sheathed cable with the power points being of the modern square pin 13 amp type.
Gas	None.
Water, plumbing, bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply.</p> <p>Distribution pipework, where seen, is formed in copper together with uPVC soil and waste pipes.</p> <p>The Bathroom comprises a bath with electric shower fitting over, basin and WC.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>It would appear that there is a back boiler at the Lounge fireplace which serves a series of radiators. Hot water is heated by the back boiler and supplemented by an immersion heater.</p>
Drainage	<p>Drainage covers etc. were not lifted.</p> <p>Neither drains nor drainage systems were tested.</p> <p>Water borne to the public sewer.</p>
Fire, smoke and burglar alarms	<p>Visually inspected.</p> <p>No tests whatsoever were carried out to the system or appliances.</p> <p>Smoke detectors have been fitted, but did not appear to be in working order. It is likely that smoke/heat detectors and carbon monoxide monitors will have to be upgraded to comply with new legislation to come into effect in 2022.</p>
Any additional limits to inspection	<p>Cupboards were all full of stored items thus limiting the inspection.</p> <p>Furnishings restricted the inspection of internal walls and joinery.</p> <p>There were floor coverings throughout which restricted the inspection of the flooring.</p> <p>Stored items below the Kitchen sink blocked any view of the pipework.</p> <p>We have not inspected the woodwork or other parts of the structure</p>

which were covered, unexposed or inaccessible and are, therefore, unable to report that such parts of the property are free from rot, beetle or other such defects.

No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns, then they should ask for a specialist to undertake appropriate tests. Asbestos is not harmful unless fibres are released into the air.


Random testing for dampness was undertaken internally with the use of a moisture meter to walls, ceilings and flooring where considered appropriate.

The services, electrical circuits, plumbing installation, heating and drainage systems have not been specifically tested.

We do not carry out an inspection for Japanese Knotweed, which is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. We have assumed that there is no Japanese Knotweed within the boundaries of the property or in neighbouring properties. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists, removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

The property was full of furnishings and personal property, together with debris, which restricted the inspection. The Lounge, Kitchen and front Bedroom, in particular, were only inspected from the vicinity of their door off the Hall/Landing.

Sectional Diagram showing elements of a typical house

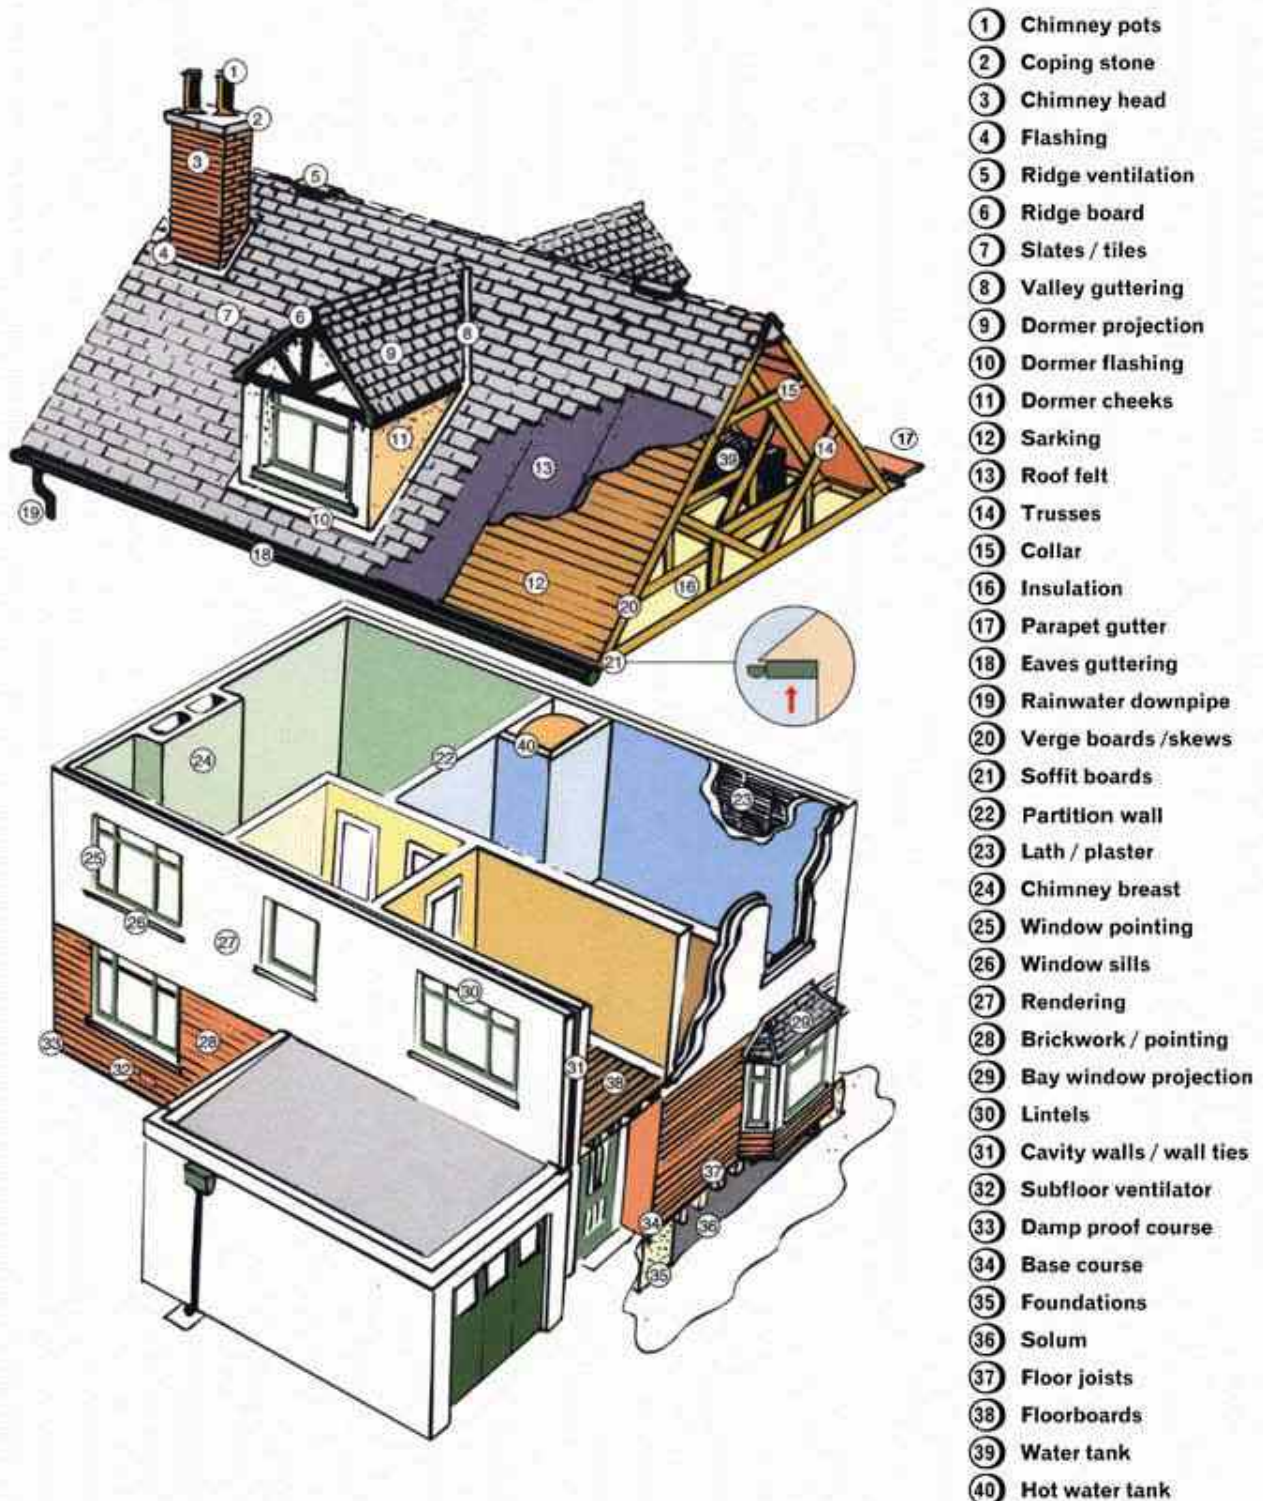


Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


Single Survey


2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	2
Notes	There is evidence of some structural movement to the house with cracking evident to the external render and door steps, and in particular to the outbuilding with cracks noted to both the front and rear. The structural integrity of the house does not appear to have been significantly impaired, however works may be required to the outbuilding. The cracks should be monitored to ensure further movement does not occur and the advice of a Structural Engineer would be prudent.

 Dampness, rot and infestation	
Repair category	1
Notes	<p>There has been a leak from the Bathroom which has resulted in the collapse of the Kitchen ceiling (see Water Section).</p> <p>Readings taken within the property, where appropriate, with an electronic protimeter, were found to be within tolerable standards and no evidence of any significant dampness was recorded.</p> <p>There was no evidence of any significant rot or infestation seen to be affecting the internal fabric of the building.</p>

 Chimney stacks	
Repair category	2
Notes	Weathered coping blockwork noted, together with vegetation growth.



Roofing including roof space

Repair category	2
Notes	<p>There is evidence of weathering to the roof tiles, along with vegetation growth which will require to be removed.</p> <p>Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectancy around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A roofing contractor will be able to advise on life expectancy and repair/replacement costs.</p> <p>Internally, insulation is considered to be inadequate by present day standards.</p>



Rainwater fittings

Repair category	3
Notes	Vegetation growth, along with seepage stains were noted to the guttering and general maintenance is required.



Main walls

Repair category	2
Notes	The main outer walls of the property generally appeared in fair order consistent with age. Although, as previously stated, there is evidence of cracking to the render.



Windows, external doors and joinery

Repair category	3
Notes	Both the outer doors are in need of replacement and the windows are of an age where ongoing maintenance should be anticipated. Not all the windows were able to be opened due to furnishings Replacement/double glazed windows can be problematic and over time the operation of the windows can be affected and opening mechanisms damaged. It is therefore likely that maintenance repairs will be required as part of an on-going maintenance programme. Our valuation does assume that the installation of the windows does comply with the necessary regulations at the time of installation.





External decorations


Repair category	2
Notes	External decoration is weathered.


Single Survey


 Conservatories/porches	
Repair category	-
Notes	Not applicable.

 Communal areas	
Repair category	-
Notes	Not applicable.

 Garages and permanent outbuildings	
Repair category	2
Notes	<p>As previously stated, there is evidence of structural movement to the Store. Timber decay noted to external woodwork. The roof coverings may contain asbestos material. The informed opinion is that these materials offer no hazard to health whilst they remain intact and undisturbed. Specialist advice and appropriate precautions should be taken prior to disturbing any material which could potentially contain asbestos fibres which may be hazardous to health if released into the atmosphere.</p> <p>No internal access was possible to the Store.</p>

 Outside areas and boundaries	
Repair category	2
Notes	<p>Garden grounds were overgrown and the fencing is in a poor state of repair. Debris was also noted to have been left within the garden grounds, which will require to be removed. The handrails on both front and rear doorsteps are rusted and in need of replacement.</p>

 Ceilings	
Repair category	3
Notes	<p>Part of the Kitchen ceiling has collapsed due to a water leak and requires to be reinstated. There are water stains to the Lounge ceiling as well.</p>

 Internal walls	
Repair category	1
Notes	<p>No significant defects were noted, although the inspection was limited to the presence of furnishings/personal items.</p>

Single Survey



Floors including sub-floors

Repair category	1
Notes	There was no visible evidence to suggest any significant defects to the flooring, however, my inspection was restricted due to furnishings and floor coverings.



Internal joinery and kitchen fittings

Repair category	3
Notes	The Kitchen is in need of refurbishment and elements of the internal joinery to include skirtings, architraves and internal doors also require replacement/general overhaul.



Chimney breasts and fireplaces

Repair category	1
Notes	Due to the concealed nature of flues within chimneys, we are not able to assess the internal condition of enclosed flues. Older flues in particular are susceptible to heat related damage. Flues with sealed up fireplace openings should be vented and a suitable terminal fitted to the chimney pots to prevent rain from entering the flue and causing dampness inside the house. Flues to open fireplaces should be swept at least once a year if they are in use and any gas appliances, such as fires and boilers, which are connected to traditional flues should be serviced at least once a year to make sure they are safe and that the flues are working correctly.



Internal decorations

Repair category	2
Notes	Once remedial works are completed, the property will require redecoration.



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	3
Notes	The property is empty and the electrical installation disconnected. This will require to be tested prior to purchase to ensure that it is safe and complies with regulations.

Single Survey



Gas

Repair category	-
Notes	Not applicable.



Water, plumbing and bathroom fittings

Repair category	3
Notes	The cause of the water damage to the Kitchen ceiling will require to be investigated and repaired. Bathroom fittings are worn and dated and require upgrading/replacement.



Heating and hot water

Repair category	3
Notes	The central heating system is dated and consideration should be given to upgrading it. As the property is empty, the installation should be checked over to ensure it is in a safe condition to use.



Drainage

Repair category	1
Notes	No surface indication of any defect noted.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	2
Dampness, rot and infestation	1
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	3
Main walls	2
Windows, external doors and joinery	3
External decorations	2
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	3
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	3
Chimney breasts and fireplaces	1
Internal decorations	2
Cellars	-
Electricity	3
Gas	-
Water, plumbing and bathroom fittings	3
Heating and hot water	3
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground and First.
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

I have assumed that Scottish Ownership exists and that there are no onerous conditions or restrictive servitudes contained in the Title.

Estimated reinstatement cost for insurance purposes

The property should be insured for a sum of no less than £140,000 (One Hundred and Forty Thousand Pounds). Building costs are currently increasing significantly above inflation due to material and labour shortages as well as Brexit and the Pandemic. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

Valuation and market comments

The current Market Value of the heritable subjects, with the benefit of vacant possession would be fairly stated in a figure of £85,000 (Eighty Five Thousand Pounds).

It is recommended that where repairs, defects or maintenance items have been identified interested parties make appropriate enquiries in order to satisfy themselves for potential costs of the extent of the works required prior to submitting a legal offer to purchase.

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Signed	Security Print Code [487002 = 9607] Electronically signed
Report author	A F Gunn
Company name	ALLIED SURVEYORS SCOTLAND PLC
Address	209 High Street, Elgin, IV30 1DJ
Date of report	3rd August 2021

Mortgage Valuation Report

Property Address

Address 2 Moray Street, Hopeman, Elgin, IV30 5SA
Seller's Name
Date of Inspection 30th July 2021

Property Details

Property Type House Bungalow Purpose built maisonette Converted maisonette
 Purpose built flat Converted flat Tenement flat Flat over non-residential use
 Other (specify in General Remarks)

Property Style Detached Semi detached Mid terrace End terrace
 Back to back High rise block Low rise block Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? Yes No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? Yes No
No. of units in block

Approximate Year of Construction

Tenure

Absolute Ownership Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) Yes No

Garage / Parking / Outbuildings

Single garage Double garage Parking space No garage / garage space / parking space
Available on site? Yes No

Permanent outbuildings:

Semi-detached Store.

Mortgage Valuation Report

Construction

Walls Brick Stone Concrete Timber frame Other (specify in General Remarks)
Roof Tile Slate Asphalt Felt Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? Yes No

If Yes, is this recent or progressive? Yes No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? Yes No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage Mains Private None Water Mains Private None
Electricity Mains Private None Gas Mains Private None
Central Heating Yes Partial None

Brief description of Central Heating:

Solid fuel back boiler serving radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way Shared drives / access Garage or other amenities on separate site Shared service connections
 Ill-defined boundaries Agricultural land included with property Other (specify in General Remarks)

Location

Residential suburb Residential within town / city Mixed residential / commercial Mainly commercial
 Commuter village Remote village Isolated rural property Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? Yes No

If Yes provide details in General Remarks.

Roads

Made up road Unmade road Partly completed new road Pedestrian access only Adopted Unadopted

Mortgage Valuation Report

General Remarks

The property is in need of maintenance, repair and refurbishment. Repairs are necessary to the chimney, roof coverings, rainwater goods and external joinery. Internally there is previous water damage to the Kitchen ceiling and the Kitchen and Bathroom will require to be refurbished, along with a new Kitchen ceiling installed. In addition, all the services require to be checked prior to use. There is evidence of previous structural movement although the structural integrity does not appear to have been significantly impaired. Monitoring of the cracks is advised.

Essential Repairs

Estimated cost of essential repairs £ Retention recommended? Yes No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The subjects will form a suitable security for mortgage purposes.

Valuations

Market value in present condition £
Market value on completion of essential repairs £
Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)
Is a reinspection necessary? Yes No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £
Is the property in an area where there is a steady demand for rented accommodation of this type? Yes No

Declaration

Signed Security Print Code [487002 = 9607]
Electronically signed by:-
Surveyor's name A F Gunn
Professional qualifications MRICS
Company name ALLIED SURVEYORS SCOTLAND PLC
Address 209 High Street, Elgin, IV30 1DJ
Telephone 01343 547481
Fax 01343 549774
Report date 3rd August 2021