

YOUR ONESURVEY HOME REPORT

ADDRESS

6 Duntrune Terrace
Broughty Ferry, Dundee
DD5 1LF

PREPARED FOR

Yvonne Yauld

INSPECTION CARRIED OUT BY:

DM HALL
CHARTERED SURVEYORS

SELLING AGENT:

Rosie Fraser Real Estate

HOME REPORT GENERATED BY:

oneSURVEY | 
HOME REPORT

Document Index

Document	Status	Prepared By	Prepared On
Index of Documents			
<u>Single Survey</u>	Final	D M Hall - Dundee	17/03/2023
<u>Mortgage Certificate</u>	Final	D M Hall - Dundee	16/03/2023
<u>Property Questionnaire</u>	Final	Ms. Yvonne Yauld	
<u>EPC</u>	Final	D M Hall - Dundee	17/03/2023

Important Notice:

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. **Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.**

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.

P A R T 1 .

SINGLE SURVEY

A report on the condition of the property, with categories
being rated from 1 to 3.



Single Survey

Survey report on:

Surveyor Reference	DD230167
---------------------------	----------

Customer	Ms. Yvonne Yauld
-----------------	------------------

Selling address	6 Duntrune Terrace Broughty Ferry, Dundee DD5 1LF
------------------------	---

Date of Inspection	14/03/2023
---------------------------	------------

Prepared by	Christopher Stark, MRICS D M Hall - Dundee
--------------------	---

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an

arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- *There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- *There are no particularly troublesome or unusual legal restrictions;
- *There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

“Re-instatement cost” is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	Two Storey Semi Detached Villa.
Accommodation	Ground Floor: Entrance Vestibule and Hallway, Living Room, Dining Room, Dining Kitchen with Conservatory Off, Shower Room and Utility Area. First Floor: Split Level Upper Hallway, Four Bedrooms and Bathroom.
Gross internal floor area (m2)	187 sq.m. or thereby
Neighbourhood and location	The property forms part of an established residential area within Broughty Ferry. The surrounding properties in the immediate vicinity are generally of a comparable style and class of construction. A range of typical local amenities can be found nearby. The property is located within the local conservation area.
Age	120 years approximately.
Weather	Overcast and dry following generally similar conditions.
Chimney stacks	Visually inspected with the aid of binoculars where required. Chimney stacks are in place being of stone construction, pointed externally and support a range of clay pots. Cement skews and metal flashings are in place at the junctions to the roof slope coverings.

Roofing including roof space	<p>Sloping roofs were visually inspected with the aid of binoculars where required.</p> <p>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.</p> <p>The roofs are of pitched hipped style being overlaid in natural slate having metal fixings. Metal flashings are in place to roof slope junctions.</p> <p>Access to the main roof space is available via a ceiling hatch within a bedroom. This shows the roof is formed in timber joists and trusses supporting timber sarking. There was a provision of insulation material laid over the ceiling joists.</p> <p>Access to the roof space of the rear projection is via a ceiling hatch within the bathroom. This appears to be of similar construction.</p>
Rainwater fittings	<p>Visually inspected with the aid of binoculars where required.</p> <p>Half round cast iron and UPVC gutters are installed which connect to suitable downpipes.</p>
Main walls	<p>Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.</p> <p>The property is of traditional stone construction with the walls being approximately 0.6m thick and primarily having a pointed external finish. Some areas have a roughcast finish.</p> <p>A utility projection is in place being of thin profile wall construction, finished externally in timber panelling.</p> <p>I would make the reasonable assumption that a suitable damp proof course was installed within the property at the time of construction, in line with regulations at the time. There was a provision of sub floor ventilation.</p>
Windows, external doors and joinery	<p>Random windows were opened and closed where possible. Doors and windows were not forced open.</p> <p>Single glazed timber framed windows are installed, several of which are fitted with secondary glazing panels internally.</p>

	The front access door is of timber panel style with a single glazed pane above.
External decorations	<p>Visually inspected.</p> <p>The frames and surrounds of the timber windows and doors are painted alongside the cast iron rainwater fittings and some wall finishes.</p>
Conservatories / porches	<p>Visually inspected.</p> <p>There is a conservatory to the rear of the property accessed from the dining kitchen. This is formed with half height roughcast finished walls, supporting double glazed timber framed window units beneath a pitched perspex roof.</p>
Communal areas	None
Garages and permanent outbuildings	<p>Visually inspected.</p> <p>The property has a detached vehicle garage in the rear garden which has an attached store. The structures are of brick construction, pointed externally beneath pitched roofs overlaid in cement asbestos sheeting.</p> <p>No internal access was available.</p>
Outside areas and boundaries	<p>Visually inspected.</p> <p>The property has garden grounds to the front, side and rear. The front and side gardens are surfaced in monoblock paving providing off street vehicle parking and access to the garage, alongside areas surfaced in chip stones and shrubbery being bound by stone walls and hedging. The rear garden is surfaced in concrete paving, grass and shrubbery being bound by timber fencing and stone walls.</p>
Ceilings	<p>Visually inspected from floor level.</p> <p>The ceilings are of lath/plaster construction. Traditional cornice and ceiling rose features are in place at parts.</p>
Internal walls	<p>Visually inspected from floor level.</p> <p>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</p> <p>The internal walls and partitions are of lath/plaster and plaster on the hard construction.</p>
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.

	<p>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</p> <p>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</p> <p>The floors are formed in suspended timber joists being overlaid with timber tongue and groove boarding. Some areas are formed in solid concrete.</p> <p>No sub floor access was available.</p>
Internal joinery and kitchen fittings	<p>Built-in cupboards were looked into but no stored items were moved.</p> <p>Kitchen units were visually inspected excluding appliances.</p> <p>The internal doors consist of timber panel and timber/glazed units being fitted with moulded facings and surrounds.</p> <p>The kitchen is fitted with a range of base and wall units having compatible worktops.</p>
Chimney breasts and fireplaces	<p>Visually inspected. No testing of the flues or fittings was carried out.</p> <p>An open fire remains in place within the living room. Some fireplace openings are fitted with gas fires.</p> <p>Other original fireplace openings have been blocked.</p>
Internal decorations	<p>Visually inspected.</p> <p>The internal walls and ceilings mostly have a papered or painted finish.</p> <p>The internal joinery fitments are finished in paint.</p>
Cellars	<p>Visually inspected where there was safe and purpose-built access.</p> <p>There are no cellars.</p>
Electricity	<p>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and</p>

	<p>efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed. The electricity fusebox is located within a cupboard in the entrance vestibule.</p>
Gas	<p>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.</p> <p>Mains supply installed. The gas meter is located within an external box.</p>
Water, plumbing and bathroom fittings	<p>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.</p> <p>Mains supply installed. The bathroom and shower room and fitted with white and coloured suites. A stainless steel sink unit and side drainer is fitted within the kitchen. Visible pipework is made of copper and PVC materials.</p>
Heating and hot water	<p>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>A floor mounted gas fired Ideal Mexico boiler within the kitchen, provides a system of radiators and is also likely to provide a hot water cylinder which is presumed to be located within a built in cupboard in the kitchen.</p>
Drainage	<p>Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.</p> <p>Drainage is connected to the main sewer.</p>
Fire, smoke and burglar alarms	<p>Visually inspected. No tests whatsoever were carried out to the system or appliances.</p> <p>There is a provision of smoke alarms in the property.</p> <p>Legislation by the Scottish Government, took effect from</p>

	<p>February 2022, and requires residential properties to have a system of inter-linked smoke alarms, carbon monoxide detectors and heat detectors. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.</p>
Any additional limits to inspection	<p>An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.</p> <p>The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring. My inspection of the roof covering was restricted from ground level and some parts were not visible. Surrounding buildings/site topography partially blocked sight lines. My inspection of the main roof space was restricted to the area around the access hatch and by the provision of insulation materials. My inspection of the rear projection roof space was severely limited due to the presence of insulation materials being laid over the access hatch. My inspection was conducted from beneath the hatch. I was not able to inspect the sub floor area. No sub floor access hatch was found. No access was available internally to the garage or attached store. My inspection of garden areas was restricted due to the overgrown nature of some parts. Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.</p> <p>I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties. The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor. Any such materials should not be drilled or disturbed without prior advice from a specialist. Random testing for dampness was undertaken internally</p>

with the use of a moisture meter where accessible and considered appropriate. In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved. Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection. Concealed areas beneath and around bath were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required. Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further. My inspection was consequently restricted and I would underline it is outwith the scope of my inspection to test the services within the property.

Sectional Diagram showing elements of a typical house



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category:	1
Notes:	<p>There is movement in the property evidenced by cracking, sloping floors, door lintels off level and plaster cracking etc. A Structural Engineers report has been recently undertaken which has made some recommendations and deemed "The structure is not in unsafe condition and no sudden dramatic deterioration would be expected in the near future which would threaten stability".</p> <p>The report should be read/retained and any recommended works carried out under long term guarantee.</p>

Dampness, rot and infestation	
Repair category:	3
Notes:	<p>A recently undertaken Structural Engineers report has recommended investigations to be carried out to an internal area. This report also states previous damp/rot repairs have been undertaken to the property, and whilst now historic in nature, any relating details/documentation should be retained. There is evidence of current dampness at various heights to numerous walls and concealed timbers may be defective. This may be relation to a recent leak which has caused damage to ceiling areas. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repair work implemented.</p> <p>There is evidence of condensation at part. This may be alleviated by a proper balance of heating and ventilation. This should be</p>

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	monitored. Further advice can be obtained from a specialist contractor.
--	---

Chimney stacks	
Repair category:	2
Notes:	<p>The finishes of the chimney stacks show signs of weathering. There is vegetation growth to mortar joints.</p> <p>All unused pots and outlets should be capped/blocked to prevent the ingress of moisture.</p>

Roofing including roof space	
Repair category:	2
Notes:	<p>Some weathered and chipped slates were noted alongside external staining. Within the roof space moisture staining was noted to some timbers which appears old. Several redundant wasps nests were noted.</p> <p>A reputable roofing contractor can provide further advice. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are older. Regular ongoing maintenance should be anticipated, particularly after periods of adverse weather.</p>

Rainwater fittings	
Repair category:	2
Notes:	Corrosion was noted. A missing end cap was identified to a section of gutter.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Main walls	
Repair category:	2
Notes:	<p>Cracking was noted to some areas and a recently undertaken Structural Engineers report has recommended repairs (see Structural Movement section above/Structural Engineers report).</p> <p>Weathering and erosion were noted to external stonework alongside damage to decorative stonework features. Cement repointing has been carried out to some areas which is not advised building practice.</p> <p>The wall of the utility space is of basic thin profile construction.</p>

Windows, external doors and joinery	
Repair category:	2
Notes:	<p>The windows are of an older style and whilst several have secondary glazing units fitted internally, externally the windows are weathered with repairs being required at parts. A reputable joiner can advise on all necessary repairs.</p>

External decorations	
Repair category:	2
Notes:	<p>Outside paintwork has deteriorated and redecoration is now required. Regular re-painting of external joinery will prolong its life span.</p>

Conservatories / porches

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	1
Notes:	Cracking was noted internally to plasterboard finishes. There is a build up of condensation within the roofing panels.

Communal areas	
Repair category:	
Notes:	Not applicable.

Garages and permanent outbuildings	
Repair category:	2
Notes:	The garage and outbuilding contain asbestos based materials. See information on Asbestos in the Limitations of Inspection section above. The structures show signs of weathering/ageing and require upgrading and maintenance. Damage was noted to the vehicle access door. Creeping plants were noted externally. Heavy moss growth was noted to roof coverings.

Outside areas and boundaries	
Repair category:	2
Notes:	Some garden areas are overgrown/unkept and would benefit from regular ongoing maintenance. Weathering was identified and ongoing maintenance to boundaries

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

	will be required.
--	-------------------

Ceilings	
Repair category:	3
Notes:	<p>There is plaster cracking and damage/collapse to some ceilings in relation to a previous leak. When plaster starts to pull loose from the laths the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair.</p> <p>Cracked and damaged plaster finishes require repair. There are original features/ornate plasterwork detailing and repair of these can be expensive even if only small areas are disturbed. This often leads to more extensive work being necessary.</p>

Internal walls	
Repair category:	2
Notes:	<p>Adverse moisture readings were recorded to areas and there is a risk of damage/decay to adjacent and concealed parts. This may be in relation to a recent leak. See Dampness, rot and infestation section above.</p> <p>Cracked and damaged plaster finishes should be repaired prior to redecorating.</p> <p>Areas of uneven walling/lath and plaster sections were noted at parts. Removal and renewal may be required.</p>

Floors including sub-floors	
Repair category:	2

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:	<p>Floor timbers in contact with damp walls may be affected by decay/rot. See Dampness, Rot & Infestation section above.</p> <p>Sloped and off level areas of flooring were noted. See Structural Movement section above.</p> <p>It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.</p>
--------	--

Internal joinery and kitchen fittings	
Repair category:	2
Notes:	<p>Glazed inserts of interior doors/panels may not be of appropriate toughened glass or meet the recognised Building Standards.</p> <p>The kitchen fittings are of a basic and mixed age/style.</p>

Chimney breasts and fireplaces	
Repair category:	2
Notes:	<p>The gas fires are of an older style. All gas fires should be tested for safety prior to use by a Gas Safe registered contractor.</p> <p>Flues should ideally be swept and tested on an annual basis.</p> <p>Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented.</p>

Internal decorations

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	2
Notes:	The renewal of decoration will be required in accordance with required repairs.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	2
Notes:	<p>The electrical installation is dated. Testing by a qualified NICEIC/SELECT registered electrician may suggest replacement or identify issues not readily visible.</p> <p>Testing should be undertaken in relation to a recent and widespread leak which may have affected electrical components.</p>

Gas	
Repair category:	1
Notes:	Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Water, plumbing and bathroom fittings

Repair category:	2
Notes:	<p>A recent leak from within the roof space has caused widespread issues and damage to adjacent areas. I am informed this has been repaired. The fitments are of an older style and ongoing maintenance should be anticipated.</p> <p>The water supply is currently turned off and drained down. Defects can appear when services are reintroduced. Reinstatement should be undertaken by a suitably qualified contractor.</p>

Heating and hot water

Repair category:	2
Notes:	<p>The central heating boiler and system are of an older style. A Gas Safe registered contractor can advise further.</p> <p>It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.</p> <p>Boilers and central heating systems should be tested and serviced by a Gas Safe registered engineer on an annual basis to ensure their safe and efficient operation.</p>

Drainage

Repair category:	1
Notes:	No significant defects evident.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	3
Chimney stacks	2
Roofing including roof space	2
Rainwater fittings	2
Main walls	2
Windows, external doors and joinery	2
External decorations	2
Conservatories / porches	1
Communal areas	
Garages and permanent outbuildings	2
Outside areas and boundaries	2
Ceilings	3
Internal walls	2
Floors including sub-floors	2
Internal joinery and kitchen fittings	2
Chimney breasts and fireplaces	2
Internal decorations	2
Cellars	
Electricity	2
Gas	1
Water, plumbing and bathroom fittings	2
Heating and hot water	2
Drainage	1

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance Notes on Accessibility Information

Three steps or fewer to a main entrance door of the property: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
3. Is there a lift to the main entrance door of the property?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
4. Are all door openings greater than 750mm?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
5. Is there a toilet on the same level as the living room and kitchen?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6. Is there a toilet on the same level as a bedroom?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
7. Are all rooms on the same level with no internal steps or stairs?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The property has been altered by the construction of a rear elevation conservatory. This alteration may have involved the enlargement of a window opening to accommodate access doors serving the conservatory. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland. Details of any restrictions/limitations this may impose on the property should be clarified.

A Structural Engineers report has been recently undertaken and made several recommendations. The report should be read, retained and all recommended works carried out under long-term guarantee.

The contents of the Structural Engineers report may be required to be brought the attention of the proposed buildings insurer.

Estimated re-instatement cost (£) for insurance purposes

910,000

NINE HUNDRED AND TEN THOUSAND POUNDS. It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS). For Listed buildings and historic properties within Conservation Areas you should seek further specialist insurance advice.

Valuation (£) and market comments

290,000

The Market Value for the property may be fairly stated at £290,000, (TWO HUNDRED AND NINETY THOUSAND POUNDS).

Following buoyant market conditions over a prolonged period through the Covid 19 Pandemic, there are now indications of a return to a more balanced level of supply and demand, partly influenced by current economic circumstances and changing interest rates.

Report author:	Christopher Stark, MRICS
Company name:	D M Hall - Dundee
Address:	Shed 26, Unit 34 City Quay Dundee DD1 3JA
Signed:	Electronically Signed: 226841-5cc6ae54-0250
Date of report:	17/03/2023

P A R T 2 .

MORTGAGE VALUATION REPORT

Includes a market valuation of the property.





Mortgage Valuation Report

Property:	6 Duntrune Terrace Broughty Ferry, Dundee DD5 1LF	Client: Ms. Yvonne Yauld Tenure: Absolute Ownership
Date of Inspection:	14/03/2023	Reference: DD230167

This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of the reports contents. Neither the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.

1.0 LOCATION

The property forms part of an established residential area within Broughty Ferry. The surrounding properties in the immediate vicinity are generally of a comparable style and class of construction. A range of typical local amenities can be found nearby.

The property is located within the local conservation area.

2.0 DESCRIPTION 2.1 Age: 120 years approximately.

Two Storey Semi Detached Villa.

3.0 CONSTRUCTION

Walls are stone, roof is slate.

4.0 ACCOMMODATION

Ground Floor: Entrance Vestibule and Hallway, Living Room, Dining Room, Dining Kitchen with Conservatory Off, Shower Room and Utility Area.

First Floor: Split Level Upper Hallway, Four Bedrooms and Bathroom.

5.0 SERVICES (No tests have been applied to any of the services)

Water:	Mains	Electricity:	Mains	Gas:	Mains	Drainage:	Mains
Central Heating:	Gas fired radiator system.						

6.0	OUTBUILDINGS				
Garage:		Single garage on site.			
Others:		Brick store.			
7.0	GENERAL CONDITION - <i>A building survey has not been carried out, nor has any inspection been made of any woodwork, services or other parts of the property which were covered, unexposed or inaccessible. The report cannot therefore confirm that such parts of the property are free from defect. Failure to rectify defects, particularly involving water penetration may result in further and more serious defects arising. Where defects exist and where remedial work is necessary, prospective purchasers are advised to seek accurate estimates and costings from appropriate Contractors or Specialists before proceeding with the purchase. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site contamination.</i>				
<p>The property forms part of an established residential area within Broughty Ferry. The surrounding properties in the immediate vicinity are generally of a comparable style and class of construction. A range of typical local amenities can be found nearby. The property is located within the local conservation area.</p> <p>In general terms, the property was found to now be in a condition requiring several items of maintenance and upgrading works to be undertaken alongside there being scope for modernisation throughout. These items may generally be attended to during the course of routine works.</p> <p>A Structural Engineers report has been recently undertaken and made several recommendations. The report should be read, retained and all recommended works carried out under long-term guarantee.</p> <p>The property has been altered by the construction of a rear elevation conservatory. This alteration may have involved the enlargement of a window opening to accommodate access doors serving the conservatory. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.</p> <p>The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland. Details of any restrictions/limitations this may impose on the property should be clarified.</p>					
8.0	ESSENTIAL REPAIR WORK <i>(as a condition of any mortgage or, to preserve the condition of the property)</i>				
<p>A Structural Engineers report has been recently undertaken and made some recommendations. The report should be read, retained and all recommended works carried out under long-term guarantee.</p> <p>The Market Valuation is made on the expectation that upon estimates being sought, the cost of the recommended repairs are not inordinately high, in relation to the size and age of the property.</p>					
8.1 Retention recommended:		None required.			
9.0	ROADS & FOOTPATHS				
Roads are adopted.					
10.0	BUILDINGS INSURANCE (£):	910,000	GROSS EXTERNAL FLOOR AREA	241 sq.m.	Square metres
<i>This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.</i>					
11.0	GENERAL REMARKS				
<p>The property has been altered by the construction of a rear elevation conservatory. This alteration may have involved the enlargement of a window opening to accommodate access doors serving the conservatory. It is assumed all</p>					

necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

The property is located in a conservation area and as such the cost of repair or reinstatement works are likely to be higher than normal. Any works considered necessary will require to be carried out in consultation with the Local Authority Planning Department and Historic Environment Scotland. Details of any restrictions/limitations this may impose on the property should be clarified.

A Structural Engineers report has been recently undertaken and made several recommendations. The report should be read, retained and all recommended works carried out under long-term guarantee.

The contents of the Structural Engineers report may be required to be brought the attention of the proposed buildings insurer.

12.0	VALUATION <i>On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.</i>		
12.1	Market Value in present condition (£):	290,000	TWO HUNDRED AND NINETY THOUSAND POUNDS.
12.2	Market Value on completion of essential works (£):		
12.3	Suitable security for normal mortgage purposes?	Yes	
12.4	Date of Valuation:	14/03/2023	
Signature:		Electronically Signed: 226841-5cc6ae54-0250	
Surveyor:	Christopher Stark	MRICS	Date: 16/03/2023
D M Hall - Dundee			
Office:	Shed 26, Unit 34 City Quay Dundee DD1 3JA		Tel: 01382 873100 Fax: email: dundee@dmhall.co.uk

P A R T 3 .

ENERGY REPORT

A report on the energy efficiency of the property.



energy report

energy report on:

Property address	6 Duntrune Terrace Broughty Ferry, Dundee DD5 1LF
-------------------------	---

Customer	Ms. Yvonne Yauld
-----------------	------------------

Customer address	6 Duntrune Terrace Broughty Ferry, Dundee DD5 1LF
-------------------------	---

Prepared by	Christopher Stark, MRICS D M Hall - Dundee
--------------------	---

Energy Performance Certificate (EPC)

Scotland

Dwellings

6 DUNTRUNE TERRACE, BROUGHTY FERRY, DUNDEE, DD5 1LF

Dwelling type: Semi-detached house
Date of assessment: 14 March 2023
Date of certificate: 17 March 2023
Total floor area: 185 m²
Primary Energy Indicator: 451 kWh/m²/year

Reference number: 9341-1006-2207-4847-0204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£20,706	See your recommendations report for more information
Over 3 years you could save*	£12,741	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

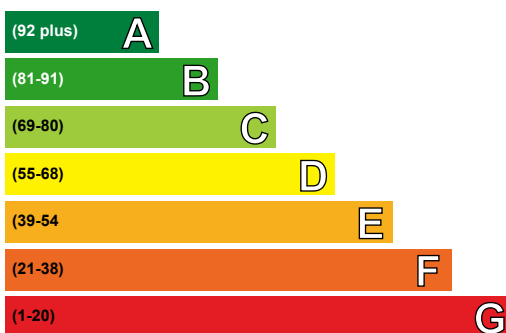

Not energy efficient - higher running costs

Current	Potential
40	82


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band E (40)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

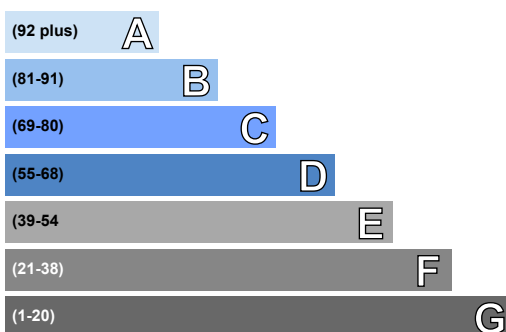

Not environmentally friendly - higher CO₂ emissions

Current	Potential
32	77

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band F (32)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£4719.00
2 Floor insulation (suspended floor)	£800 - £1,200	£1491.00
3 Draughtproofing	£80 - £120	£549.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 300 mm loft insulation Pitched, 250 mm loft insulation	★★★★★ ★★★★☆	★★★★★ ★★★★☆
Floor	Suspended, no insulation (assumed)	—	—
Windows	Partial secondary glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, no room thermostat	★☆☆☆☆	★☆☆☆☆
Secondary heating	Room heaters, mains gas	—	—
Hot water	From main system, no cylinder thermostat	★★☆☆☆	★★☆☆☆
Lighting	Low energy lighting in 36% of fixed outlets	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.


The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 80 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 15 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 10.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

















Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£16,902 over 3 years	£6,432 over 3 years	
Hot water	£2,751 over 3 years	£885 over 3 years	
Lighting	£1,053 over 3 years	£648 over 3 years	
Totals	£20,706	£7,965	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£1573		
2 Floor insulation (suspended floor)	£800 - £1,200	£497		
3 Draughtproofing	£80 - £120	£183		
4 Low energy lighting for all fixed outlets	£45	£108		
5 Upgrade heating controls	£350 - £450	£407		
6 Replace boiler with new condensing boiler	£2,200 - £3,000	£1307		
7 Replace single glazed windows with low-E double glazed windows	£3,300 - £6,500	£174		
8 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£629		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Draughtproofing

Fitting draughtproofing, strips of insulation around windows and doors, will improve the comfort in the home. A contractor can be employed but draughtproofing can be installed by a competent DIY enthusiast.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

5 Heating controls (room thermostat and thermostatic radiator valves)

A room thermostat will increase the efficiency of the heating system by enabling the boiler to switch off when no heat is required; this will reduce the amount of energy used and lower fuel bills. Thermostatic radiator valves should also be installed, to allow the temperature of each room to be controlled to suit individual needs, adding to comfort and reducing heating bills provided internal doors are kept closed. For example, they can be set to be warmer in the living room and bathroom than in the bedrooms. Ask a competent heating engineer to install thermostatic radiator valves and a fully pumped system with the pump and the boiler turned off by the room thermostat. Thermostatic radiator valves should be fitted to every radiator except for the radiator in the same room as the room thermostat. Remember the room thermostat is needed to enable the boiler to switch off when no heat is required, thermostatic radiator valves on their own do not turn the boiler off. Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

6 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority building standards department and seek advice from a qualified heating engineer.

7 Double glazed windows

Double glazing is the term given to a system where two panes of glass are made up into a sealed unit. Replacing existing single-glazed windows with double-glazed windows will improve comfort in the home by reducing draughts and cold spots near windows. Double-glazed windows may also reduce noise, improve security and combat problems with condensation. Building regulations apply to this work and planning permission may also be required, so it is best to check with your local authority on what standards need to be met. A building warrant is not required if the windows comply with the current requirements.

8 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	34,384	N/A	N/A	(9,913)
Water heating (kWh per year)	5,365			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Christopher Stark
Assessor membership number:	EES/011887
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Shed 26, Unit 34 City Quay Camperdown Street Dundee DD1 3JA
Phone number:	01592 598200
Email address:	christopher.stark@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



P A R T 4 .

PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property Questionnaire

Property Address

6 Duntrune Terrace
Broughty Ferry, Dundee
DD5 1LF

Seller(s)

Yvonne Yauld

Completion date of property questionnaire

Note for sellers

1.	Length of ownership																
	How long have you owned the property? 35 years																
2.	Council tax																
	Which Council Tax band is your property in? (Please circle) <input type="checkbox"/> A <input type="checkbox"/> B <input type="checkbox"/> C <input type="checkbox"/> D <input type="checkbox"/> E <input checked="" type="checkbox"/> F <input type="checkbox"/> G <input type="checkbox"/> H																
3.	Parking																
	What are the arrangements for parking at your property? (Please tick all that apply) <table> <tr> <td>Garage</td> <td><input checked="" type="checkbox"/></td> </tr> <tr> <td>Allocated parking space</td> <td><input type="checkbox"/></td> </tr> <tr> <td>Driveway</td> <td><input checked="" type="checkbox"/></td> </tr> <tr> <td>Shared parking</td> <td><input type="checkbox"/></td> </tr> <tr> <td>On street</td> <td><input type="checkbox"/></td> </tr> <tr> <td>Resident permit</td> <td><input type="checkbox"/></td> </tr> <tr> <td>Metered parking</td> <td><input type="checkbox"/></td> </tr> <tr> <td colspan="2">Other (please specify):</td> </tr> </table>	Garage	<input checked="" type="checkbox"/>	Allocated parking space	<input type="checkbox"/>	Driveway	<input checked="" type="checkbox"/>	Shared parking	<input type="checkbox"/>	On street	<input type="checkbox"/>	Resident permit	<input type="checkbox"/>	Metered parking	<input type="checkbox"/>	Other (please specify):	
Garage	<input checked="" type="checkbox"/>																
Allocated parking space	<input type="checkbox"/>																
Driveway	<input checked="" type="checkbox"/>																
Shared parking	<input type="checkbox"/>																
On street	<input type="checkbox"/>																
Resident permit	<input type="checkbox"/>																
Metered parking	<input type="checkbox"/>																
Other (please specify):																	

	Conservation area
--	--------------------------

4.		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> Don't know
5.	Listed buildings	
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
6.	Alterations/additions/extensions	
a	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, please describe below the changes which you have made: <i>Conservatory</i>	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
b	Have you had replacement windows, doors, patio doors or double glazing installed in your property	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(ii) Did this work involve any changes to the window or door openings?	<input type="checkbox"/> YES <input type="checkbox"/> NO
	(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed): Please give any guarantees which you received for this work to your solicitor or estate agent.	

7.	Central heating	
a	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	[x]YES []NO []Partial
	If you have answered yes or partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). Gas	
	If you have answered yes, please answer the three questions below:	
	(i) When was your central heating system or partial central heating system installed? Approx 20 years	
	(ii) Do you have a maintenance contract for the central heating system?	[]YES [x]NO
	If you have answered yes, please give details of the company with which you have a maintenance contract	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	[x]YES []NO
9.	Issues that may have affected your property	
a	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	[]YES [x]NO
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	[]YES []NO
b	Are you aware of the existence of asbestos in your property?	[]YES []NO [x]Don't know
	If you have answered yes, please give details:	
10.	Services	
a	Please tick which services are connected to your property and give details of the supplier:	

	<table border="1"> <tr> <th>Services</th><th>Connected</th><th>Supplier</th></tr> <tr> <td>Gas or liquid petroleum gas</td><td>Y</td><td></td></tr> <tr> <td>Water mains or private water supply</td><td>N</td><td></td></tr> <tr> <td>Electricity</td><td>Y</td><td></td></tr> <tr> <td>Mains drainage</td><td>Y</td><td></td></tr> <tr> <td>Telephone</td><td>Y</td><td></td></tr> <tr> <td>Cable TV or satellite</td><td>N</td><td></td></tr> <tr> <td>Broadband</td><td>N</td><td></td></tr> </table>	Services	Connected	Supplier	Gas or liquid petroleum gas	Y		Water mains or private water supply	N		Electricity	Y		Mains drainage	Y		Telephone	Y		Cable TV or satellite	N		Broadband	N	
Services	Connected	Supplier																							
Gas or liquid petroleum gas	Y																								
Water mains or private water supply	N																								
Electricity	Y																								
Mains drainage	Y																								
Telephone	Y																								
Cable TV or satellite	N																								
Broadband	N																								
b	Is there a septic tank system at your property?	[]YES [x]NO																							
	If you have answered yes, please answer the two questions below:																								
	(i) Do you have appropriate consents for the discharge from your septic tank?	[]YES []NO []Don't know																							
	(ii) Do you have a maintenance contract for your septic tank?	[]YES []NO																							
	If you have answered yes, please give details of the company with which you have a maintenance contract:																								
11.	Responsibilities for shared or common areas																								
a	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	[]YES [x]NO []Don't know																							
b	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	[]YES [x]NO []N/A																							
c	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	[]YES [x]NO																							
d	Do you have the right to walk over any of your neighbours' property- for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	[]YES [x]NO																							
e	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	[]YES [x]NO																							

	If you have answered yes, please give details:	
f	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.) If you have answered yes, please give details:	[]YES [x]NO
12.	Charges associated with your property	
a	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	[]YES [x]NO
b	Is there a common buildings insurance policy?	[]YES [x]NO []Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factors charges?	
c	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	[]YES [x]NO
	If you have answered yes, please give details:	
c	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	[]YES []NO
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	

14.	Guarantees	
a	Are there any guarantees or warranties for any of the following:	
(i)	Electrical work	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(ii)	Roofing	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iii)	Central heating	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(iv)	National House Building Council(NHBC)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(v)	Damp course	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	<input checked="" type="checkbox"/> NO <input type="checkbox"/> YES <input type="checkbox"/> Don't know <input type="checkbox"/> With title deeds <input type="checkbox"/> Lost
b	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):	
c	Are there any outstanding claims under any of the guarantees listed above?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO
	If you have answered yes, please give details:	

15.	Boundaries	
	So far as you are aware, has any boundary of your property been moved in the last 10 years?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> Don't know
	If you have answered yes, please give details:	
16.	Notices that affect your property	
In the past three years have you ever received a notice:		
a	advising that the owner of a neighbouring property has made a planning application?	<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO
b	that affects your property in some other way?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO

c	that requires you to do any maintenance, repairs or improvements to your property?	[]YES [x]NO
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s) I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.	
Signature(s):	Yvonne Auld
Capacity:	[]Owner [x]Legally Appointed Agent for Owner
Date:	12/03/2023