

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

Property address	407 Field Of Dreams, Findhorn, Forres, IV36 3TA
Customer	Ms S Phelps
Customer address	407 Field Of Dreams, Findhorn, IV36 3TA
Prepared by	Harvey Donaldson And Gibson
Date of inspection	1st November 2019



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a two storey end terraced house.
Accommodation	The Accommodation comprises -
	Ground Floor - Entrance Hall, Bedroom, Bathroom, Living Room and Kitchen.
	First Floor - Landing/Living Room, Shower Room and Bedroom with a Study off.
Gross internal floor area (m²)	The gross internal floor area extends to 88sq m or thereby.
Neighbourhood and location	The property is situated within the Findhorn Foundation which is a spiritual community and well known for their ecovillage. The Foundation has local amenities on site however a wider range of amenities can be found in the village of Findhorn or the town of Forres.
Age	13 years.
Weather	It was dry at the time of the inspection.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate.
	We have been advised that the chimneyhead is of pumice/Isokern Block construction, dressed in metal flashings, where visible from ground level.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.	
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.	
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.	
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.	
	The roof is pitched, timber framed and covered with profiled metal sheeting. We understand that Warmcell 500 insulation is present between the rafters.	
	There are three solar panels mounted to the front elevation of the roof.	
Deinverter fittinge		
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.	
	Rainwater discharge is via stainless steel gutters and downpipes.	
Main walls	Visually inspected with the aid of binoculars where appropriate.	
	Foundations and concealed parts were not exposed or inspected.	
	The main external walls are timber framed and clad with larch timber and Eternit Cedral weatherboarding externally.	
	According to plans, the walls have been insulated with dry blown Warmcell 500 recycled cellulose insulation.	
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.	
	Random windows were opened and closed where possible.	
	Doors and windows were not forced open.	
	The windows are of a softwood timber construction and double glazed.	
	There are velux windows located in the living room and to the first floor level.	
	The front and rear doors are of timber construction with glazed inserts.	
	The fascia boards (gutter boards) at the eaves of the roof are timber.	

Fotomed decree 2	
External decorations	Visually inspected.
	The external decorations are finished with a decorative stain.
	We have been advised that the decorative stain is used with an Eco Friendly water based stain.
Conservatories / porches	Not applicable.
Communal areas	Circulation areas visually inspected.
	There is a boiler/laundry room located to the rear of the property which houses the communal biomass boiler and communal washing machine. The boiler room area appears to be timber framed and clad with Eternit Cedral weatherboarding externally and under profiled metal sheeting.
	There is an attached pellet shed located to the side of the boiler room.
Garages and permanent outbuildings	Please refer to the 'Communal Areas' section.
Outside areas and boundaries	Visually inspected.
	There are garden grounds to the front, side and rear of the property. The grounds mostly consist of laid grass, raised beds, decking and planted shrubs. There is a lock- block pathway to the front of the property which leads to the entrance door.
	There is a timber shed clad with Eternit Cedral weatherboarding located in the rear garden, however this is not considered a permanent outbuilding for home report purposes.
	There are various unallocated parking spaces located nearby and around the Park.
	According to plans, the rear garden area is communal between the three terraces, however we understand these areas are now being used individually, inline with the property perimeter.
Ceilings	Visually inspected from floor level.
	Ceilings throughout the property are of plasterboard materials.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal partitions are of timber stud design, plasterboard lined on both faces.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are of suspended timber construction and according to plans, have been insulated with Warmcell 500 cellulose insulation between the joists.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are flush faced timber units.
	The skirting boards and door surrounds are timber.
	The staircase is timber.
	The kitchen fittings consist of a range of floor and wall mounted units with a stainless steel sink.
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	There is a wood-burning stove located in the living room with the flue connected to the chimney breast.
Internal decorations	Visually inspected.
	The ceilings and walls are painted.
	The bathroom, shower room and kitchen are finished with tiles.
Cellars	Not applicable.
-	real applicable.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

We understand that electricity is supplied by New Findhorn Directions Ltd. The electricity is generated via three wind turbines and a number of PV panels located on the Park. The meter is located in an external box and the consumer unit is located in the cupboard under the stairs. The system appears to be of a 13 amp type and design. The switch and socket outlets are plastic and the wiring is sheathed with PVC, where visible.

Gas

No main gas available.

Water, plumbing, bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

We understand the water is supplied from New Findhorn Directions.

The bathroom contains a bath with shower over, wash hand basin and w.c.

The shower room contains a shower, wash hand basin and w.c.

The visible pipework is a mixture of copper and plastic.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

The property is centrally heated by means of a communal biomass boiler (Kunzel Type PL25) which is individually metered between three properties.

Heating to the rooms is mostly provided by water filled radiators, however thermaskirt heating is present in the living room and first floor landing/living area. Hot water is provided by the biomass boiler and the three solar panels which are mounted on the roof. Hot water is supplemented by an electric immersion heater and the hot water cylinder is located in the upstairs shower room.

The heating system was last serviced 2 August 2019.

Drainage

Drainage covers etc were not lifted.

Neither drains nor drainage systems were tested.

The property is believed to be connected to the Foundations solar aquatic biological sewage treatment plant.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property has smoke detectors and a carbon monoxide alarm.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The property was inspected within the limits imposed by occupation which included, floor coverings, stored items, furnishings etc. The owner's personal belongings were not removed from cupboards.

This report does not constitute a full and detailed description of the property and a structural investigation was not carried out. No inspection was undertaken of woodwork or other parts of the structure which are covered, unexposed or otherwise inaccessible and as a result no guarantee can be given that such parts of the structure are free from rot, beetle or other defects.


The external building fabric has been inspected from ground level only from the subjects grounds and where possible from adjoining public property. Exposure work has not been carried out.

It was dry on the date of inspection. Leakage and water penetration within roof spaces, chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.

No sub-floor inspection was possible due to no apparent means of access.

There is no roof space available for inspection due to the roof design.

Sectional Diagram showing elements of a typical house

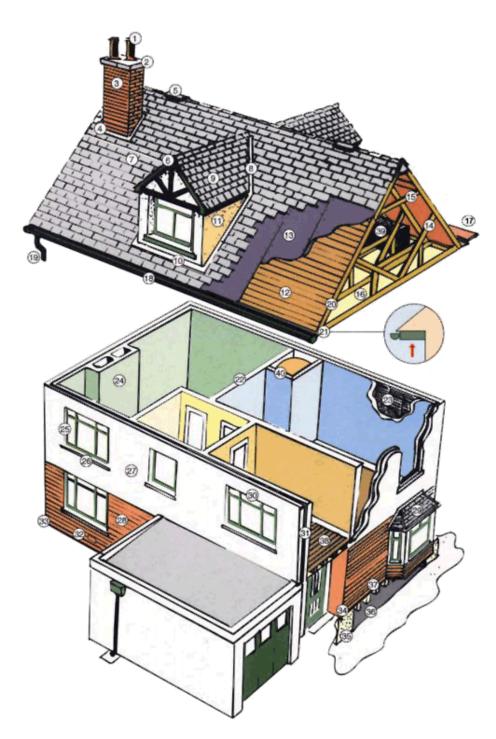

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- 15) Collar
- 16 Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
 - 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.

Dampness, rot and infestation	
Repair category	1
Notes	An electronic moisture meter was used to measure levels of dampness, at random locations, to lower wall surfaces and floors, where accessible and without moving furniture or lifting floor coverings, if present. No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	1
Notes	From a ground level inspection, no obvious significant defects were noted to the chimneyhead.

Roofing including roof space	
Repair category	1
Notes	No obvious significant defects were noted to the roof coverings.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to the rainwater goods, allowing for visible vegetation noted to the rear gutter. Choked rainwater units can lead to serious defects in other parts of the building if not repaired timeously. It will be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to the accessible wall surfaces, allowing for normal weathering.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to the windows, doors or external joinery.

External decorations	
Repair category	1
Notes	No obvious significant defects noted, allowing for normal weathering.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	1
Notes	No obvious significant defects were noted to the communal areas.

Garages and permanent outbuildings	
Repair category	-
Notes	Please refer to the 'Communal Areas' section.

Outside areas and boundaries	
Repair category	1
Notes	Outside areas appear adequate for purpose, however, on going maintenance should be envisaged.
	The boundaries are ill defined. Please refer to Section 4 – Matters for solicitor or licensed conveyancer.

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to the ceiling surfaces.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to the internal walls.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to the flooring, within the limitations imposed by fully fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No obvious significant defects were noted to the internal joinery or kitchen fittings.

Chimney breasts and fireplaces	
Repair category	1
Notes	No obvious significant defects were noted to the wood-burning stove. Flue linings (and stove appliances) require at least annual inspections by a reputable person specialising in flues and chimneys. Specialist inspection of the stove and flue is recommended prior to use.

Internal decorations	
Repair category	1
Notes	No obvious significant defects were noted to the internal decoration.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	1
Notes	It is likely that only the most recently rewired properties will have electrical installations that fully comply with current regulations. The installation in this property has been tested with the next test due in 2023. It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.

d Gas	
Repair category	-
Notes	Not applicable.

► Water, plumbing and bathroom fittings	
Repair category	1
Notes	No obvious significant defects noted to the accessible plumbing or sanitary fittings.
	The property is connected to a private water supply which should be tested periodically for purity
	Given the presence of the shower mounted over the bath, it is essential that all wall linings, tile grout, seals, etc are maintained in good condition. Failure to do so can lead to concealed defects behind wall finishes, and below the bath. As the bath is boxed in, it will be appreciated that it is not possible to comment on concealed locations.

Heating and hot water	
Repair category	1
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested. It is recommended good practice that boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records.

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes No X
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

The property is of non-traditional construction, and clarification should be sought from the chosen Lending Institution that this property type meets their lending criteria.

The property has been altered internally, whereby an opening has been moved. It is assumed that all necessary Local Authority consents and approvals are in place for these works. alterations made internally.

The legal adviser should obtain full details of any service charge payable for maintenance of the estate common areas. We also understand there is a separate payment contract between the three terraces in regards to the boiler and laundry room which should be clarified.

The subjects exact boundaries are not clearly defined. Please refer to Section 4 – Matters for solicitor or licensed conveyancer.

The property is within the Findhorn Foundation community and there are understood to be restrictive conditions on ownership of these properties. Full details should be obtained prior to purchase. This could affect mortgageability and future value.

The legal adviser should confirm that all necessary rights of access exist.

Water, electricity and drainage are understood to be from a communal supply / system provided by the Findhorn Park Community.

Estimated reinstatement cost for insurance purposes

We are of the opinion that the current reinstatement value for insurance purposes can be fairly stated in the region of:

£175,000 (One hundred and seventy five thousand pounds sterling).

Valuation and market comments

We are of the opinion that the current open market value of the property, in the condition found at the time of our inspection, and assuming full vacant possession on 1 November 2019 can be fairly stated in the sum of:

£290,000 (Two hundred and ninety thousand pounds sterling).

Signed	Security Print Code [499017 = 5138]O Electronically signed	
	, 3	

Report author	India Hill
Company name	Harvey Donaldson And Gibson
Address	Park House Business Centre, South Street, Elgin, IV30 1JB
Date of report	8th November 2019



Property Address	
Address Seller's Name Date of Inspection	407 Field Of Dreams, Findhorn, Forres, IV36 3TA Ms S Phelps 1st November 2019
Property Details	
Property Type	X House Bungalow Purpose built maisonette Converted maisonette Purpose built flat Converted flat Flat over non-residential use Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace ☒ End terrace □ Back to back □ High rise block □ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes No ilitary, police?
Flats/Maisonettes only	y Floor(s) on which located No. of floors in block Lift provided? Yes No No. of units in block
Approximate Year of	Construction 2006
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	2 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 2 Bathroom(s) 0 WC(s) 1 Other (Specify in General remarks)
Gross Floor Area (exc	cluding garages and outbuildings) 88 m² (Internal) 104 m² (External)
Residential Element (greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	□ Double garage □ Parking space X No garage / garage space / parking space □ Yes □ No
Permanent outbuildin	gs:
There is a boiler/lau communal washing	ndry room located to the rear of the property which houses the communal biomass boiler and machine.

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Other	(specify in Gen	eral Remarks)
Roof	Tile	Slate	Asphalt	Felt	X Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property s	suffered struct	ural movemer	nt?			Yes	X No
If Yes, is this recei	nt or progress	ive?				Yes	☐ No
Is there evidence, immediate vicinity		son to anticip	ate subsidence,	heave, landslip o	or flood in the	Yes	X No
If Yes to any of the	e above, provi	de details in C	General Remark	S.			
Service Connec	tion						
		If any committee		non maine place		n tha tuna a	
Based on visual in of the supply in Ge			es appear to be	non-mains, pieas	e comment o	n the type ar	nd location
Drainage	Mains	X Private [None	Water	Mains	X Private	None
Electricity	Mains	X Private [None	Gas	Mains	Private	X None
Central Heating	X Yes	Partial	None				
Brief description o	f Central Heat	ing:					
Heating fuel: Sol							
Heating type: Ra							
ricating type. Re	idiatoro.						
Site							
Apparent legal iss	ues to be veri	fied by the co	nveyancer. Plea	se provide a brief	description in	n General R	emarks.
X Rights of way	X Shared drive	es / access [Garage or other	amenities on separate	e site X Shar	ed service conn	ections
X III-defined boundari	es	Agricultu	ral land included wit	h property	Othe	r (specify in Ge	neral Remarks)
Location							
Residential suburb	Res	idential within tov	vn / city Mixe	d residential / comme	rcial Main	ly commercial	
X Commuter village	Rem	note village	Isola	ted rural property	Othe	r (specify in Ge	neral Remarks)
Planning Issues	;						
Has the property b	een extended	I / converted /	altered? X	res No			
If Yes provide deta	ails in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly o	ompleted new road	Pedestrian a	access only	Adopted	Unadopted

General Remarks

The property is situated within the Findhorn Foundation which is a spiritual community and well known for their ecovillage. The Foundation has local amenities on site however a wider range of amenities can be found in the village of Findhorn or the town of Forres.

The general condition of the property appears consistent with age and type of construction.

The 'other' room in the accommodation section is the Study.

The main external walls are timber framed and clad with larch timber and Eternit Cedral weatherboarding externally.

The roof is pitched, timber framed and covered with profiled metal sheeting.

The property is of non-traditional construction, and clarification should be sought from the chosen Lending Institution that this property type meets their lending criteria.

The property has been altered internally, whereby an opening has been moved. It is assumed that all necessary Local Authority consents and approvals are in place for these works. alterations made internally.

The legal adviser should obtain full details of any service charge payable for maintenance of the estate common areas. We also understand there is a separate payment contract between the three terraces in regards to the boiler and laundry room which should be clarified.

The subjects exact boundaries are not clearly defined. Please refer to Section 4 – Matters for solicitor or licensed conveyancer.

The property is within the Findhorn Foundation community and there are understood to be restrictive conditions on ownership of these properties. Full details should be obtained prior to purchase. This could affect mortgageability and future value.

The legal adviser should confirm that all necessary rights of access exist.

Water, electricity and drainage are understood to be from a communal supply / system provided by the Findhorn Park Community.

Essential Repairs						
None apparent within the limitations of our inspection.						
Estimated cost of essential repairs £	Retention recommended? Yes	X No	Amount £			

Comment on Mortgageability					
The property affords adequently lender's criteria.	quate security for loan purposes based on the valuation figure, subject to i	ndividual			
Valuations					
Market value in present condition £ 29 Market value on completion of essential repairs £					
What is the reasonable rangementh Short Assured Tenar	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£			
	where there is a steady demand for rented accommodation of this type?	Yes No			
Declaration					
Signed Surveyor's name Professional qualifications Company name	Security Print Code [499017 = 5138]O Electronically signed by:- India Hill AssocRICS Harvey Donaldson And Gibson Park House Business Centre, South Street, Elgip, IV30.1 IB				
Address Park House Business Centre, South Street, Elgin, IV30 1JB Telephone 01343547844 Tax 0203 880 9193 Report date 8th November 2019					

Energy Performance Certificate (EPC)

Dwellings

Scotland

407 FIELD OF DREAMS, FINDHORN, FORRES, IV36 3TA

Dwelling type: End-terrace house
Date of assessment: 01 November 2019
Date of certificate: 02 November 2019

Total floor area: 87 m²

Primary Energy Indicator: 172 kWh/m²/year

Reference number: 9130-2909-1190-9701-2055 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Community scheme

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,079	See your recommendations
Over 3 years you could save*	£81	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

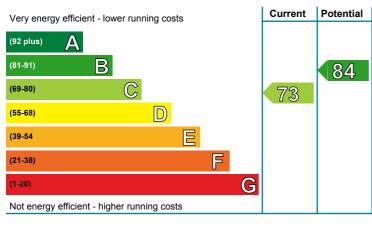


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (73)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

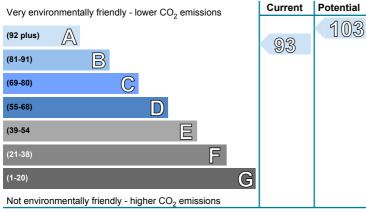

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band A (93)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Low energy lighting	£35	£78.00
2 Solar photovoltaic (PV) panels	£3,500 - £5,500	£864.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	★★★★ ☆
Roof	Pitched, insulated (assumed)	****	★★★★ ☆
Floor	Suspended, insulated (assumed)	_	_
Windows	Fully double glazed	****	****
Main heating	Community scheme	****	****
Main heating controls	Charging system linked to use of community heating, programmer and TRVs	***☆	****
Secondary heating	Room heaters, wood logs	_	_
Hot water	Community scheme, plus solar	****	****
Lighting	Low energy lighting in 56% of fixed outlets	****	★★★ ☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 9 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 0.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,542 over 3 years	£1,554 over 3 years	
Hot water	£237 over 3 years	£237 over 3 years	You could
Lighting	£300 over 3 years	£207 over 3 years	save £81
	Totals £2,079	£1,998	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indiantive and	Typical saving	Rating after improvement		
		Indicative cost per year		Energy	Environment	
1	Low energy lighting for all fixed outlets	£35	£26	C 74	A 94	
2	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£288	B 84	A 103	

Choosing the right improvement package



For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting).

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass community heating
- Biomass secondary heating
- Solar water heating

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	7,663	N/A	N/A	N/A
Water heating (kWh per year)	2,341			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Miss India Hill Assessor membership number: EES/019913

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors

Address: The Park House Business Centre

South Street Elgin IV30 1JB

Phone number: 01343547844

Email address: frances.wilson@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Completion date of property

questionnaire

PROPERTY QUESTIONNAIRE

Property address	407 Field of Dreams, The Park, Findhorn, Moray, IV36 3TA
Seller(s)	Ms Sally Phelps

31.10.19





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership					
	How long have you owned the property? 4yrs 1 month					
2,	Council tax					
	Which Council Tax band is your property in? (Please tick)					
	A B C D E F G H					
3.	Parking					
	What are the arrangements for parking at your property? (Please tick all that apply)					
	Garage					
	Allocated parking space					
	Driveway					
	Shared parking					
	On street					
	Resident permit					
	Metered parking					
	Other (please specify): Designated car parks wit allocated	hin the Park not				
4.	Conservation area					
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes No Don't know				
5.	Listed buildings					
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes No				
6.	Alterations/additions/extensions					
a.	(i) During your time in the property, have you carried					
	out any structural alterations, additions or extensions	Yes				



	(for example, provision of an extra bath/shower room, toilet, or bedroom)?	No	
	If you have answered yes, please describe below the changes which you have made:		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes No	
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or		
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	Yes No	
	(iii) Please describe the changes made to the windows (doors (with approximate dates when the work was completed):	doors, or p	atio
	Please give any guarantees which you received for this solicitor or estate agent.	work to yo	our
7.	Central heating		
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property —	Yes No Partial	



	the main living room, the bedroom(s), the hall and the bathroom).			
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	Biomass wood pellet boiler shared between 407, 407A and 408		
	If you have answered yes, please answer the three questions below:			
	i) When was your central heating system or partial central heating system installed?	2005		
	(ii) Do you have a maintenance contract for the central heating system?	Yes 🖂		
	If you have answered yes, please give details of the company with which you have a maintenance contract:	Green Flame Installations Ltd, Grantown-on-Spey do an annual service, without contract.		
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	Boiler serviced in August 2019		
8.	Energy Performance Certificate			
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes 🖂		
9.	Issues that may have affected your property			
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No		
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No		
b.	Are you aware of the existence of asbestos in your property?	Yes No		
	If you have answered yes, please give details:			



10.	Services						
	ease tick which services pplier:	are connected to	your property a	and give details	s of		
Servi	ces	Connected	Supplier				
Gas o	or liquid petroleum gas						
Water mains or private water supply		yes	New Fi Ltd (NFD)	indhorn Directions			
Elect	tricity	yes	NFD				
Main	s drainage	yes	NFD	net			
Tele	phone	yes	Plusnet				
Cable	e TV or satellite	No		,			
Broa	dband	yes	Plusnet	lusnet			
b.	Is there a septic tank of the se	yes, please answer priate consents for ntenance contract yes, please give de	the two the discharge for your	Yes No Yes No Don't know Yes No			
11.	Responsibilities for sh						
а.	Are you aware of any recost of anything used justing shared drive, private re	ointly, such as the r	epair of a	Yes No Don't know			
	If you have answered y	es, please give deta	ails:	Shared			
				boiler/laundr	v		



		room, and
		washing
		machine
b.	1 41	Yes
	Is there a responsibility to contribute to repair and	No.
	maintenance of the roof, common stairwell or other	Don't know
	common areas?	Shared
	If you have answered yes, please give details:	boiler/laundry
		room and
		contents
C.	Has there been any major repair or replacement of any	Yes
	part of the roof during the time you have owned the	No 🖂
	property?	
d.		Yes
		No 🗆
	Do you have the right to walk over any of your	
	neighbours' property — for example to put out your	
	rubbish bin or to maintain your boundaries?	
		common path
	If you have answered yes, please give details:	behind houses
	il you liave allswered yes, please give details.	to access
		shared
		boiler/laundry
		room
		Yes
	As for as you are aware do any of your waln't have	No
	As far as you are aware, do any of your neighbours have	NO
	the right to walk over your property, for example to put	
e.	out their rubbish bin or to maintain their boundaries?	
٥.		only for access
	If you have answered yes, please give details:	to wood pellet
		storage shed
		behind no 407
	As far as you are aware, is there a public right of way	Yes
	across	No 🖂
	any part of your property? (public right of way is a way	
	over	
f.	which the public has a right to pass, whether or not the	
	land is	
	privately-owned.)	
	If you have answered yes, please give details:	



and the second

12.	Charges associated with your property	
12. a.	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	Yes No New Findhorn Directions Ltd, The Park, Findhorn, IV36 3TZ HoCo charge of £423 per annum
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes Some Some Some Some Some Some Some Some
C.	Please give details of any other charges you have to pay of for the upkeep of common areas or repair works, for exam association, or maintenance or stair fund. Included in HoCo charge (as above) paid to NFD Ltd or Titleholders Association covers estate roads, paths and maintenance and repairs, etc	ple to a residents'
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	Yes No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes No
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be	Yes No



needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14. Guarantees a. Are there any guarantees or warranties for any of the following: No							
No Yes Don't know With title deeds	14.	Guarantees					
(i) Electrical work (ii) Roofing (iii) Central heating (iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	a.	Are there any guarantees or warranties for any of the following:					
(iii) Roofing (iii) Central heating (iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	-				Don't	With title	Lost
(iii) Central heating (iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	(i)	Electrical work			\boxtimes		
(iv) National House Building Council (NHBC) (v) Damp course (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	(ii)	Roofing			\boxtimes		
(IV) (NHBC) (V) Damp course (Vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details:	(iii)	Central heating			\boxtimes		
(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? Yes No If you have answered yes, please give details:	(iv)				\boxtimes		
(for example, cavity wall insulation, underpinning, indemnity policy) b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? Yes No If you have answered yes, please give details:	(v)	Damp course					
work or installations to which the guarantee(s) relate(s): c. Are there any outstanding claims under any of the guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details: Yes No If you have answered yes, please give details: Don't know	(vi)	(for example, cavity wall insulation, underpinning, indemnity					
guarantees listed above? If you have answered yes, please give details: 15. Boundaries So far as you are aware, has any boundary of your property been moved in the last 10 years? If you have answered yes, please give details: No Don't know	b.				_	details of t	he
So far as you are aware, has any boundary of your property been moved in the last 10 years? Yes No If you have answered yes, please give details: Don't know	c.	guarantees listed above?					
property been moved in the last 10 years? Yes No If you have answered yes, please give details: Don't know	15.	Boundaries	100.00				
16. Notices that affect your property		property been moved in the last 10 years?				No	ow 🗵
	16.	Notices that affect your property					
In the past three years have you ever received a		In the past three years have you ex	er rece	eived a			



	notice:					
	advising that the owner of a neighbouring property has	Yes				
a.	made a planning application?	No	Å			
b.	that affects your property in some other way?	Yes				
.		No				
	that requires you to do any maintenance, repairs or	Yes				
C.	improvements to your property?	No	\boxtimes			
	If you have answered yes to any of a-c above, please given	ve the noti	ces to			
	your solicitor or estate agent, including any notices which arrive at any					
	time before the date of entry of the purchaser of your property.					

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):

Sally Phelps Gally Phelps

Date:

31,10,19



