







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

Property address 24 Lossie Cottages Elgin, IV30 4AW	5,
---	----

Customer Mr & Mrs D Paterson	
----------------------------------	--

Customer address	

Prepared by Harvey Donaldson And Gibson

Date of inspection 23	Brd March 2021
-----------------------	----------------

HARVEY



24 Lossie Cottages, Elgin, IV30 4AW 23rd March 2021 Roz Melen

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Х

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a bungalow which we understand was built around 1970.
	We believe it was originally constructed for the Local Authority.

Accommodation	The Accommodation comprises -
	On one floor: Ground Floor - Entrance Hall, Living room, Kitchen, One Bedroom and Shower room.

Gross internal floor area (m²)	45
--------------------------------	----

Neighbourhood and location	The property is located in an established residential area within an Elgin suburb. A full range of amenities are available within the
	town.

Age	51 years.
Weather	It was dry at the time of the inspection.
Chimney stacks None.	

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is pitched, timber supported and clad externally in concrete interlocking tiles, topped in concrete ridging.
	Access to the roof space is from a hatch in the hall ceiling. Inspection reveals a traditionally constructed roof structure comprising timber joists, rafters and lining with a brick/block party wall.
	The roof space was insulated with fibreglass quilting laid between and across the ceiling joists, and this considerably restricted the scope of inspection. As recommended by RICS guidelines, no attempt was made to move same and no comment can therefore be made regarding inaccessible or concealed timbers. Inspection was therefore of a 'head and shoulders' nature only, from the hatch.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	Rainwater discharge is via uPVC gutters and uPVC downpipes.

Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls of the property measure approximately 320mm in thickness, and are of traditional cavity brick/block construction, finished externally in render, incorporating fresh air ventilators at base course level, all plasterboard dry lined internally.

Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Replacement uPVC framed double glazed windows.
	uPVC framed doors.

External decorations Vis	sually inspected.
Exte	ernal surfaces are painted, where applicable.

Conservatories / porches	None.
Communal areas	None.
Garages and permanent outbuildings	None.
	For Home Report purposes, please note that a timber garden shed is not classed as a permanent outbuilding.

Outside areas and boundaries	Visually inspected.
	There are garden grounds to the front, side and rear, adequately bounded.
	Off street private parking is available, on an unallocated basis.
	Timber garden shed to the side.

Ceilings	Visually inspected from floor level.
	Ceilings throughout the property are of plasterboard materials.

Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal partitions are of timber stud design, plasterboard lined on both faces.

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floors are of a suspended timber type with timber joists.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Kitchen fittings comprise a range of wall and base units and work surfaces.
	Timber skirtings, door facings and door surrounds and timber internal pass doors.
	Various built-in timber cupboards.

Chimney breasts and fireplaces	None.

The ceilings and walls are painted.	

Cellars	None.
---------	-------

Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	A mains supply of electricity is connected to the property, the electrical meter and circuit breaker consumer unit located in a hall cupboard and serving 13 Amp square pin sockets throughout. Wiring, where visible, is sheathed in uPVC.

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Gas is supplied from the mains.
	The meter is located in a hall cupboard.


Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	The Shower room contains a modern shower and cubicle, wash hand basin and WC.

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is centrally heated by means of a gas fired system, comprising a combination boiler located in a hall cupboard.
	Heating to the rooms is provided by water filled radiators.
	The system is of a type designed to provide instantaneous hot water upon demand.

Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	Mains drainage is understood to be connected.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property has hard-wired smoke detectors.

Any additional limits to inspection	For flats / maisonettes
	Only the subject flat and internal communal areas giving access to the flat were inspected.
	If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.
	The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.
	The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

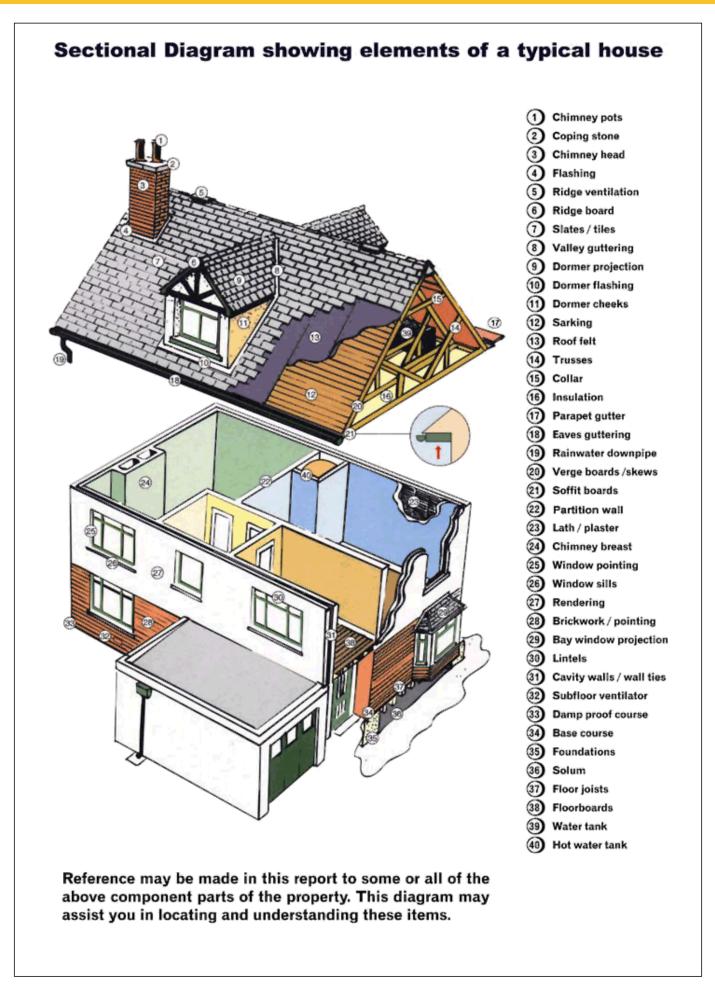

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.
	All buildings move daily and seasonally as a result of external factors such as gravity, temperature, moisture content and vibrations. Consequently most buildings will have minor non structural cracks related to these factors. Minor cracks can be filled during normal redecoration but often recur seasonally due to normal movement in a building. Non structural cracks of this nature will not be recorded or reported. There is evidence of movement in the form of cracking to walling. On the basis of a single visual inspection the movement appears to be longstanding in nature. The opinion provided is given within the limitations of a single visual inspection. It was noted that steel ties have been installed to the rear wall and steel angles to cracked lintels as a precaution against any further movement.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	2
Notes	The manufacturers of modern roof tiles expect that a roof tile will normally last for approximately 50 years. This should be taken into consideration having regard to the age of this property.
	The roof coverings appear to be in a generally satisfactory condition commensurate with its age and nature of construction.
	Verge boarding may contain asbestos fibres; if this does prove to be the case then special precautions will be required repairs are carried out.
	Some light moss cover to tiling was noted.
	At the date of inspection there was no evidence of dampness which would indicate leakage. It should be noted that it was raining at the time of our inspection.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will however be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to accessible wall surfaces.
	The walls are affected by normal weathering.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to windows, doors or external joinery. The rear access door has lost some uPVC covering. Whilst there was no obvious defect on the date of inspection, it should be appreciated that double glazed sealed units do have a limited life expectancy, and defective seals can lead to condensation between the panes, necessitating in the replacement of the unit. This can sometimes only be obvious during adverse weather conditions.

External decorations	
Repair category	1
Notes	No obvious significant defects noted.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	-
Notes	Not applicable.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	1
Notes	Outside areas and boundaries appear adequate for purpose. Garden fencing and gates are weathered and will require treatment as part of on- going annual maintenance.

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to internal walls and partitions, within the limitations imposed on the inspection.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes Internal decorations are fresh throughout.	

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	1
Notes	No obvious significant defects noted, however, only the most recently constructed or re-wired properties have installations which fully comply with current regulations. It is good practice to have electrical systems fully tested upon a change in ownership, where upgrading may be identified by the contractor.
	It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.
	We noted evidence of in-date test certification.

Gas	
Repair category	1
Notes	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings	
Repair category	1
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings. Given the presence of a shower over the tray, it is essential that all wall linings, tile grout, seals, etc are maintained in good condition. Failure to do so can lead to concealed defects behind wall finishes, and below the shower tray. As the tray is boxed in, it will be appreciated that it is not possible to comment on concealed locations.

Heating and hot water	
Repair category	1
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested. It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Estimated reinstatement cost for insurance purposes

£90,000 (Ninety thousand pounds).

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 23rd March 2021 is:

£85,000 (Eighty five thousand pounds sterling).

Property market activity has been impacted due to the current response to Covid-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of "material valuation uncertainty" as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Signed	Security Print Code [466860 = 6081]O
	Electronically signed

Report author	Mark McClelland-Jones

Company name	Harvey Donaldson And Gibson

Address	Caledonian House Business Centre, High Street, Elgin, IV30 1BD

Date of report	23rd March 2021



Property Address				
Address	24 Lossie Cottage	es, Elgin, IV30 4A	W	
Seller's Name	Mr & Mrs D Pater	son		
Date of Inspection	23rd March 2021			
Property Details				
Property Type	House	X Bungalow	Purpose built maisonette	Converted maisonette
	Purpose built flat	Converted flat	Tenement flat	Flat over non-residential use
				Other (specify in General Remarks)
Property Style	Detached	Semi detached	Mid terrace	X End terrace
	Back to back	High rise block	Low rise block	Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m		erty was built for t	he public sector,	X Yes No
Flats/Maisonettes onl	y Floor(s) on which I	located	No. of floors in block	Lift provided?
	-		No. of units in block]
Approximate Year of	Construction 1970			
_				
Tenure				
X Absolute Ownership	Leasehold	Ground rent £	Unexpired year	s
Accommodation				
Number of Rooms	1 Living room(s)	1 Bedroom(s)	1 Kitchen(s)	
	1 Bathroom(s)	0 WC(s)	0 Other (Specify in Genera	al remarks)
Gross Floor Area (ex	cluding garages an	nd outbuildings)	45 m ² (Internal) 53] m² (External)
Residential Element (greater than 40%)	X Yes No		
Garage / Parking /	Outbuildings			
Single garage	Double garage	Parkin	g space X N	lo garage / garage space / parking space
Available on site?	Yes No			
Permanent outbuildin	gs:			
Timber store.				

Construction							
Walls	X Brick	Stone	Concrete	Timber frame	Other	(specify in Ger	neral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Other	(specify in Ger	neral Remarks)
Special Risks							
Has the property s	uffered struc	tural movem	ent?			Yes	X No
If Yes, is this recei	nt or progress	sive?				Yes	No
Is there evidence, immediate vicinity'		ason to antic	ipate subsidence	e, heave, landslip o	or flood in the	Yes	X No
If Yes to any of the	e above, prov	ide details in	General Remar	KS.			
Service Connec	tion						
Based on visual in of the supply in Ge			ces appear to be	e non-mains, pleas	e comment o	on the type a	nd location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description o	f Central Hea	iting:					
Heating fuel: Gas Heating type: Ra							
Site							
Apparent legal iss	ues to be ver	ified by the c	onvevancer Ple	aso provido a brief	f description i	n General R	omarks
Rights of way		res / access		ase provide a brief		ed service conr	
Ill-defined boundari		_	Itural land included w				neral Remarks)
		3					
Location							
X Residential suburb		sidential within t mote village		ed residential / comme ated rural property		ly commercial r (specify in Ge	neral Remarks)
Planning Issues	i						
Has the property b	een extende	d / converted	I / altered?	Yes X No			
If Yes provide deta	ails in Genera	al Remarks.					
Roads							
X Made up road	Unmade roa	d 🗌 Partly	completed new road	d Pedestrian a	access only	Adopted	Unadopted

General Remarks

When inspected within limits imposed by occupation, the general condition of the property appears consistent with its age and type of construction, and no obvious significant defects were noted which would adversely affect the subjects as a mortgage security.

Essential Repairs

None noted.			
Estimated cost of essential repairs £	Retention recommended?	X No	Amount £

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure, subject to indiv	ridual
lender's criteria.	

Valuations	
Market value in present condition	£ 85,000
Market value on completion of essential repairs	£
Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 90,000
Is a reinspection necessary?	Yes X No
Buy To Let Cases	
What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?	£
Is the property in an area where there is a steady demand for rented accommodation of this type?	Yes No
Declaration	

Signed	Security Print Code [466860 = 6081]O Electronically signed by:-
Surveyor's name	Mark McClelland-Jones
Professional qualifications	AssocRICS
Company name	Harvey Donaldson And Gibson
Address	Caledonian House Business Centre, High Street, Elgin, IV30 1BD
Telephone	07725 428687
Fax	0203 880 9193
Report date	23rd March 2021

Energy Performance Certificate (EPC)

Scotland

Dwellings

24 LOSSIE COTTAGES, ELGIN, IV30 4AW

Dwelling type:	End-terrace bungalow
Date of assessment:	23 March 2021
Date of certificate:	23 March 2021
Total floor area:	45 m²
Primary Energy Indicator:	265 kWh/m ² /year

Reference number: Type of assessment: Approved Organisation: Main heating and fuel: 2671-1015-8207-8729-2200 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home


Estimated energy costs for your home for 3 years*	£1,530	See your recommendations
Over 3 years you could save*	£366	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Current

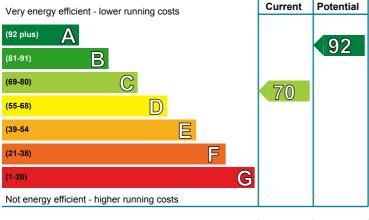

Very environmentally friendly - lower CO₂ emissions

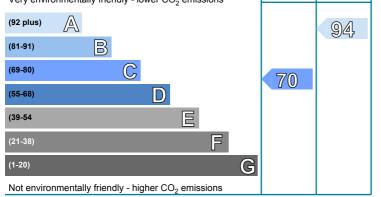

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Potential

Recommended measures	Indicative cost	Typical savings over 3 years
1 Cavity wall insulation	£500 - £1,500	£75.00
2 Floor insulation (suspended floor)	£800 - £1,200	£141.00
3 Solar water heating	£4,000 - £6,000	£66.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

24 LOSSIE COTTAGES, ELGIN, IV30 4AW 23 March 2021 RRN: 2671-1015-8207-8729-2200

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 350 mm loft insulation	****	*****
Floor	Suspended, no insulation (assumed)	_	
Windows	Fully double glazed	★★★☆☆	★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, TRVs and boiler energy manager	★★★★☆	★★★★☆
Secondary heating	None	—	_
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in 83% of fixed outlets	****	*****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 47 kg $CO_2/m^2/yr$.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

24 LOSSIE COTTAGES, ELGIN, IV30 4AW 23 March 2021 RRN: 2671-1015-8207-8729-2200

Estimated energy costs for this home

Latinated energy costs for this nome			
	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,179 over 3 years	£879 over 3 years	
Hot water	£210 over 3 years	£144 over 3 years	You could
Lighting	£141 over 3 years	£141 over 3 years	save £366
	Totals £1,530	£1,164	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Do		Indiantities as at	Typical saving	mprovement	
Re	commended measures	Indicative cost	per year	Energy	Environment
1	Cavity wall insulation	£500 - £1,500	£25	C 71	C 72
2	Floor insulation (suspended floor)	£800 - £1,200	£47	C 74	C 76
3	Solar water heating	£4,000 - £6,000	£22	C 75	C 78
4	Replacement glazing units	£1,000 - £1,400	£28	C 77	C 80
5	Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£315	A 92	A 94

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

• External insulation with cavity wall insulation

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Cavity wall insulation

Cavity wall insulation, to fill the gap between the inner and outer layers of external walls with an insulating material, reduces heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. The insulation material is pumped into the gap through small holes that are drilled into the outer walls, and the holes are made good afterwards. As specialist machinery is used to fill the cavity, a professional installation company should carry out this work, and they should carry out a thorough survey before commencing work to ensure that this type of insulation is suitable for this home and its exposure. They should also provide a guarantee for the work and handle any building standards issues. Further information about cavity wall insulation and details of local installers can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

4 Replacement glazing units

Replacing existing double-glazed units with new high-performance units. Building regulations require that replacement glazing is to a standard no worse than previous; a building warrant is not required. Planning permission might be required for such work if a building is listed or within a conservation area so it is best to check with your local authority.

5 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,292	N/A	(591)	N/A
Water heating (kWh per year)	1,602			

Addendum

Related party disclosure:

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark McClelland-Jones
Assessor membership number:	EES/020000
Company name/trading name:	Harvey Donaldson & Gibson Chartered Surveyors
Address:	Caledonian House Business Centre High Street
	Elgin
	IV30 1BD
Phone number:	01343547844
Email address:	frances.wilson@hdg.co.uk

No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.







Property address	24 Lossie Cottages, Elgin, Moray, IV30 4AW

Seller(s)	David James Paterson & mrs Isobel McDonald Paterson
-----------	--

Completion date of property	19/3/21
questionnaire	13/3/21





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership		
	How long have you owned the property? 20 years		
2.	Council tax		
	Which Council Tax band is your property in? (Please tick)		
	AX BC CO DO EO FO GO HO		
3.	Parking		
	What are the arrangements for parking at your property? (Please tick all that apply)		
	• Garage		
	• Allocated parking space		
	• Driveway		
	• Shared parking		
	• On street		
	• Resident permit		
	Metered parking		
	Other (please specify):		
4.	Conservation area		
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes No Don't know	
5.	Listed buildings		
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes No	
6.	Alterations/additions/extensions		
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes No	



	<u>If you have answered yes</u> , please describe below the changes which you have made:		
	 (ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them: 	Yes No	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	Yes No	
	(iii) Please describe the changes made to the windows doors, or patio doe approximate dates when the work was completed):Please give any guarantees which you received for this work to your solution.		gent.
7.	Central heating		
а.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes No Partial	
	If you have answered yes or partial– what kind of central heating is there?(Examples: gas-fired, solid fuel, electric storage heating, gas warm air).If you have answered yes, please answer the three questions below:	Gas Condens boiler with rad	
	i) When was your central heating system or partial central heating system installed?	2003	
	(ii) Do you have a maintenance contract for the central heating system?	Yes	\boxtimes



	If you have answered yes, please give details of the company with which you have a maintenance contract:	No British Gas	
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	Nov 2020	
8.	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes No	\square
9.	Issues that may have affected your property		
а.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No	\square
	<u>If you have answered yes</u> , is the damage the subject of any outstanding insurance claim?	Yes No	
b.	Are you aware of the existence of asbestos in your property? <u>If you have answered yes</u> , please give details:	Yes No	



10.	Services				
a. Pl	ease tick which services are	connected to your propert	y and give details of	the supplier:	
Servi	ces	Connected	Supplier		
Gas o	r liquid petroleum gas	X	British Ga	s	
	r mains or private	X	Scottish W	later authority	
	supply				
Electi	ricity	x	British Ga	S	
Mains	s drainage	X	Moray Co	uncil	
Telep	hone				
Cable	TV or satellite				
Broad	lband				
L					
b.	Is there a septic tank syst If you have answered yes	em at your property? , please answer the two que	estions below:	Yes No	
		te consents for the dischar		Yes	
	-	nance contract for your se	ntic tank?	Don't know Yes	
	-	, please give details of the c	_	No	
	which you have a mainter				
	· ·	nance contract:	,		
11.	Responsibilities for share				
11. a.	Responsibilities for share Are you aware of any respo		e cost of anything	Yes No	
	Responsibilities for share Are you aware of any respo	d or common areas onsibility to contribute to the	e cost of anything		
	Responsibilities for share Are you aware of any responsed jointly, such as the rep	d or common areas onsibility to contribute to the pair of a shared drive, privat	e cost of anything	No	
	Responsibilities for share Are you aware of any response used jointly, such as the report garden area? If you have answered yes, point yes Is there a responsibility to one	d or common areas onsibility to contribute to the pair of a shared drive, privat please give details: contribute to repair and mai	e cost of anything te road, boundary,	No	
а.	Responsibilities for share Are you aware of any response used jointly, such as the report garden area? If you have answered yes, particular of the second se	d or common areas onsibility to contribute to the pair of a shared drive, privat please give details: contribute to repair and mai	e cost of anything te road, boundary,	No Don't know	
а.	Responsibilities for share Are you aware of any response used jointly, such as the report garden area? If you have answered yes, point yes Is there a responsibility to one	d or common areas onsibility to contribute to the pair of a shared drive, privat please give details: contribute to repair and main other common areas?	e cost of anything te road, boundary,	No Don't know Yes No	
а.	Responsibilities for share Are you aware of any response used jointly, such as the report garden area? If you have answered yes, particular statements Is there a responsibility to a roof, common stairwell or a roof, common stairwell or a roof, common stairwell or a roof. If you have answered yes, particular statements Has there been any major particular statements	d or common areas onsibility to contribute to the pair of a shared drive, privat please give details: contribute to repair and main other common areas? please give details:	e cost of anything te road, boundary, intenance of the	No Don't know Yes No	
a. b.	Responsibilities for share Are you aware of any response used jointly, such as the report or garden area? If you have answered yes, particular Is there a responsibility to a roof, common stairwell or a roof, common stairwell or a roof, particular If you have answered yes, particular	d or common areas onsibility to contribute to the pair of a shared drive, privat please give details: contribute to repair and main other common areas? please give details:	e cost of anything te road, boundary, intenance of the	No Don't know Yes No Don't know	



d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Yes No	
	If you have answered yes, please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	Yes No	
	If you have answered yes, please give details:		
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes No	
	If you have answered yes, please give details:		
12.	Charges associated with your property		
a.	Is there a factor or property manager for your property?	Yes	
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	No	
b.	Is there a common buildings insurance policy?	Yes	
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	No Don't know	
С.	Please give details of any other charges you have to pay on a regular basis f common areas or repair works, for example to a residents' association, or n fund.		air
13.	Specialist works		
а.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes No	
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes No	
b.	If you have answered yes, please give details:		
с.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes No	



If you have answered yes, these guarantees will be needed by the	
purchaser and should be given to your solicitor as soon as possible for	
checking. If you do not have them yourself, your solicitor or estate agent	
will arrange for them to be obtained. You will also need to provide a	
description of the work carried out. This may be shown in the original	
estimate.	
Guarantees are held by:	

14.	Guarantees								
a.	Are there any guarantees or warranties for any of the following:								
		No	Yes	Don't know	With title deeds	Lost			
(i)	Electrical work	\boxtimes							
(ii)	Roofing	\boxtimes							
(iii)	Central heating		\boxtimes		\square				
(iv)	National House Building Council (NHBC)			\boxtimes					
(v)	Damp course			\boxtimes					
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	X							
b.	If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s): New Boiler installed November 2020. Boiler and repairs cover for 5 years								
с.	Are there any outstanding claims under any of above? <u>If you have answered yes</u> , please give details:	l	Yes No	M					
15.	Boundaries								
	So far as you are aware, has any boundary of yo in the last 10 years? If you have answered yes, please give details:	oved	Yes No Don't know						
16.	Notices that affect your property								
	In the past three years have you ever receive								
a.	advising that the owner of a neighbouring pr planning application?		Yes No	\mathbb{X}					
b.	that affects your property in some other way		Yes No						
с.	that requires you to do any maintenance, rep your property?	nts to	Yes No	$\square \boxtimes$					



<u>If you have answered yes to any of a-c</u> above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.

Declaration by the seller(s)/or other authorised body or person(s)

 $I/We \ confirm \ that \ the \ information \ in \ this \ form \ is \ true \ and \ correct \ to \ the \ best \ of \ my/our \ knowledge \ and \ belief.$

Signature(s): D J Paterson

Date: 19/3/21





The Park House Business Centre, South Street, Elgin IV30 1JB 01343 547844 elgin.residential@hdg.co.uk