

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

Property address	10 Moravia Apartments, Pinefield Crescent, Elgin, IV30 6LN
Customer	Mr J Lowson
Customer address	35 Chanory Road, Elgin, IV30 1XH
Prepared by	Harvey Donaldson And Gibson
Date of inspection	19th February 2020



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a purpose-built second floor flat, which forms part of a modern four storey flatted building, containing seven flats in all.
Accommodation	Ground floor: Entrance Hall, Kitchen/Diner/Living, Two Bedrooms, Bathroom, Internal Storage room, External Storage Room.
Gross internal floor area (m²)	62m2
Neighbourhood and location	The property is located in an established residential area within an Elgin suburb. A full range of amenities are available within the town.
Age	9 years.
Weather	It was dry at the time of the inspection.
Chimney stacks	None.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is pitched, timber supported and clad externally in concrete interlocking tiles, topped in concrete ridging and finished in UPVC dry verging.
	Part of the roof is flat.
	The main roof space is accessed via hatches in the internal and external storage room ceilings with the top floor flat. We were unable to enter due to this flat being in separate ownership.
Rainwater fittings	Visually inspected with the aid of binoculars where
Namwater mangs	appropriate.
	Rainwater discharge is via UPVC gutters and UPVC downpipes.
Main walls	Visually inspected with the aid of binoculars where
	appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls of the property are of modern timber framed construction, with a block/brick outer leaf finished externally in render, all plasterboard dry lined internally.
	Externally, some walls are finished with timber.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	Timber framed double glazed windows.
	Timber entrance door.
	Soffit boards are timber.
External decorations	Visually inspected.
	The external joinery is finished with a decorative stain.
	, ,
Conservatories / porches	None.


-	
Communal areas	Circulation areas visually inspected.
	There is a shared entrance with intercom access and a staircase giving access to all floors.
	There is a shared entrance hall and stairwell.
	There is a shared parking area.
	There are shared grounds.
	There is a shared drying area.
	There is a shared bin storage yard.
Garages and permanent outbuildings	None.
Outside areas and boundaries	None - communal only.
0.11	
Ceilings	Visually inspected from floor level.
	Ceilings throughout the property are of plasterboard materials.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for
	dampness where considered appropriate.
	Internal partitions are of timber stud design, plasterboard lined on both faces.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	Flooring throughout the property is of suspended timber design.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The kitchen fittings are of a contemporary design and consist of a range of floor and wall mounted units.
	The internal doors, skirting boards and door surrounds are timber.

Chimney breasts and fireplaces	None.
Internal decorations	Visually inspected.
	Painted walls and ceilings, glossed and stained internal woodwork, etc.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains electricity is installed.
	The meter and consumer unit are located in the external and internal storage rooms respectively.
	The system appears to be of a modern 13 amp type and design.
	The switch and socket outlets are plastic and the wiring is sheathed with PVC, where visible.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	A mains supply of gas is connected, the gas meter located externally in a uPVC housing.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Cold water is from the mains supply.
	Visible plumbing comprises copper and uPVC supply pipework.
	The bathroom contains a bath shower overhead, wash-hand basin and WC.

Heating and hot water Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The property is centrally heated by means of a gas fired system, comprising a condensing combination boiler located in the bedroom opposite the bathroom. Heating to the rooms is provided by water filled radiators. The system is of a type designed to provide instantaneous hot water upon demand. Drainage Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Mains drainage is understood to be connected. Fire, smoke and burglar alarms Visually inspected. No tests whatsoever were carried out to the system or appliances. The property has smoke detectors. Any additional limits to inspection For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. It was dry on the date of inspection. Leakage and water penetration within roof spaces, around chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.

Flat roofs cannot be inspected from ground level.

Sectional Diagram showing elements of a typical house

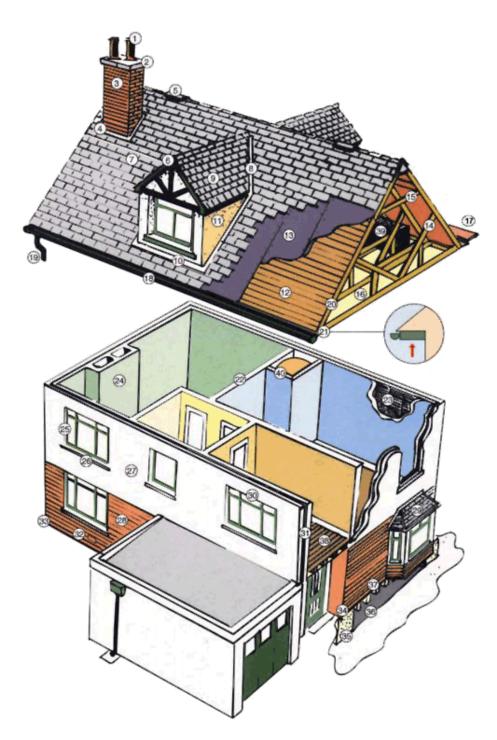

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- 12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	Roof tiling, where viewed from ground level, appears to have been laid to generally even courses with no obvious significant defects noted.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will, however, be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to accessible wall surfaces.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to windows, doors or external joinery. The condition of high level timbers is difficult to establish, particularly those in the shade or where finished with a dark coloured paint, where inspection can only be undertaken from ground level.

External decorations	
Repair category	1
Notes	No obvious significant defects noted.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	2
Notes	Wear and tear is apparent to decorations within the common close.
	The timber cupboard at the entrance hall has minor damage to the inner door.

Garages and permanent outbuildings	
Repair category	-
Notes	Not applicable.

Outside areas and boundaries	
Repair category	-
Notes	Not applicable.

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to the internal walls.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	Internal decorations are fresh throughout.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity		
Repair category	1	
Notes	No obvious significant defects noted; however, only the most recently constructe or re-wired properties have installations which fully comply with current regulations.	
	It is good practice to have electrical systems fully tested upon a change in ownership, where upgrading may be identified by the contractor.	

Gas	
Repair category	1
Notes	No obvious significant defects noted. All gas appliances should be tested and thereafter regularly maintained by a Gas Safe registered contractor.

► Water, plumbing and bathroom fittings				
Repair category	1			
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings.			

Heating and hot water				
Repair category	1			
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested.			

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	2
Garages and permanent outbuildings	-
Outside areas and boundaries	-
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Fourth floor		
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X		
3. Is there a lift to the main entrance door of the property?	Yes No X		
4. Are all door openings greater than 750mm?	Yes X No		
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No		
6. Is there a toilet on the same level as a bedroom?	Yes X No		
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No		
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No		

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

It would be prudent to check with the managing agents and/or co-proprietors as to any contemplated or proposed communal repairs.

Normal local practice is for common repairs to be shared on an equitable basis. This has been assumed to be the position in this case.

The Legal Adviser should check existence and details of acceptable management arrangements service charges and block insurance.

The valuation assumes the existence of all necessary Local Authority consents and certifications, and NHBC insurance documentation.

Access to the property is shared, and reference to the Titles will ascertain the exact ownership, maintenance and liability of same.

Estimated reinstatement cost for insurance purposes

£110,000 (One hundred and ten thousand pounds).

The rebuilding cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 19th February 2020 is:

£105,000 (One hundred and five thousand pounds sterling).

Signed	Security Print Code [603928 = 5805] Electronically signed				
Report author	Mark McClelland-Jones				

Address	Park House, South Street, Elgin, Moray, IV30 1JB				
Date of report	19th February 2020				



Property Address								
Address Seller's Name Date of Inspection	Seller's Name Mr J Lowson							
Property Details								
Property Type	☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette ☒ Purpose built flat ☐ Converted flat ☐ Flat over non-residential use ☐ Other (specify in General Remarks)							
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block ▼ Low rise block □ Other (specify in General Remarks)							
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, Yes X No nilitary, police?							
Flats/Maisonettes only	y Floor(s) on which located 1 No. of floors in block 4 Lift provided? Yes X No No. of units in block 7							
Approximate Year of 0	Construction 2011							
Tenure								
X Absolute Ownership	Leasehold Ground rent £ Unexpired years							
Accommodation								
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)							
Gross Floor Area (exc	cluding garages and outbuildings) 62 m² (Internal) m² (External)							
Residential Element ((greater than 40%) X Yes No							
Garage / Parking / 0	Outbuildings							
Single garage Available on site?	□ Double garage □ Parking space X No garage / garage space / parking space □ Yes □ No							
Permanent outbuildings:								

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Othe	r (specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Othe	r (specify in Gen	eral Remarks)
Special Risks							
Has the property	suffered stru	ctural movemer	nt?			Yes	X No
If Yes, is this rece	ent or progres	ssive?				Yes	No
Is there evidence, immediate vicinity		eason to anticip	ate subsidence	, heave, landslip o	or flood in the	e Yes	X No
If Yes to any of the	e above, pro	vide details in (General Remark	S.			
Service Connec	rtion						
		ly If any comic	aa annaar ta ba	non maina nlaga	o commont o	on the time of	ad location
Based on visual ir of the supply in G			es appear to be	non-mains, pieas	e comment d	on the type ar	id location
Drainage	X Mains	Private	None	Water	X Mains	Private	None
Electricity	X Mains	Private	None	Gas	X Mains	Private	None
Central Heating	X Yes	Partial	None				
Brief description of	of Central He	ating:					
Heating fuel: Ga	ıs.	_					
Heating type: Ra							
Site							
Apparent legal iss	sues to be ve	rified by the co	nveyancer. Plea	se provide a brief	description	in General Re	emarks.
X Rights of way	X Shared dr	ives / access [Garage or other	amenities on separate	site Sha	red service conn	ections
Ill-defined boundar	ries	Agricultu	ral land included wi	th property	Othe	er (specify in Ge	neral Remarks)
Location							
X Residential suburb	Re	esidential within tov	vn / city Mixe	ed residential / comme	rcial Mair	nly commercial	
Commuter village	Re	emote village	Isola	ited rural property	Othe	er (specify in Ge	neral Remarks)
Planning Issues	S						
Has the property I	been extende	ed / converted /	altered?	Yes X No			
If Yes provide details in General Remarks.							
Roads							
X Made up road	Unmade ro	ad Partly o	completed new road	Pedestrian a	access only	Adopted	Unadopted

General Remarks
When inspected within limits imposed by occupation, the general condition of the property appears consistent with its age and type of construction, and no obvious significant defects were noted which would adversely affect the subjects as a mortgage security.
Essential Repairs
None noted.
Estimated cost of essential repairs £ Retention recommended? YesX No Amount £

Comment on Mortgagea	bility		
The property affords adeq lender's criteria.	uate security for loan purposes based on the valuation figure, subject to i	ndividual	
Valuations			
Market value in present condition Market value on completion of essential repairs Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT) Is a reinspection necessary? Buy To Let Cases What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis?			
	here there is a steady demand for rented accommodation of this type?	YesNo	
Declaration			
Signed Surveyor's name Professional qualifications Company name Address Telephone Fax	Security Print Code [603928 = 5805] Electronically signed by:- Mark McClelland-Jones MRICS Harvey Donaldson And Gibson Park House, South Street, Elgin, Moray, IV30 1JB 07725 428687 0203 880 9193		
Report date	19th February 2020		

Energy Performance Certificate (EPC)

Dwellings

Scotland

10 MORAVIA APARTMENTS, PINEFIELD CRESCENT, ELGIN, IV30 6LN

Dwelling type: Mid-floor flat
Date of assessment: 19 February 2020
Date of certificate: 19 February 2020

Total floor area: 62 m²

Primary Energy Indicator: 91 kWh/m²/year

Reference number: 0170-2221-3220-2690-4565
Type of assessment: RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains

gas


You can use this document to:

Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£942

 st based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

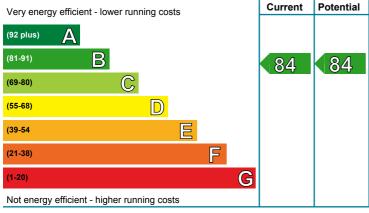


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (84)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

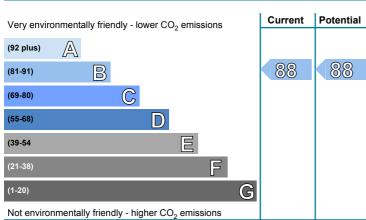

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (88)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	****	****
Roof	(another dwelling above)	_	_
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	****	★★★★ ☆
Main heating	Boiler and radiators, mains gas	****	★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	****	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	****	★★★★ ☆
Lighting	Low energy lighting in all fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 16 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.0 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£498 over 3 years	£498 over 3 years	
Hot water	£273 over 3 years	£273 over 3 years	N. (P. 11
Lighting	£171 over 3 years	£171 over 3 years	Not applicable
Totals	£942	£942	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	1,050	N/A	N/A	N/A
Water heating (kWh per year)	1.890			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Mark McClelland-Jones

Assessor membership number: EES/020000

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors

Address: The Park House Business Centre

South Street Elgin IV30 1JB

Phone number: 01343547844

Email address: frances.wilson@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.



Property address	10 Moravia Apartments Elgin Moray IV30 6LN
Seller(s)	John Lowson
Completion date of property questionnaire	18/02/2020





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership				
	How long have you owned the property? 29 Months				
2.	Council tax				
	Which Council Tax band is your property in? (Please tick)				
	A□ B⊠ C□ D□ E□ F□ G□ H□				
3.	Parking				
	What are the arrangements for parking at your property? (Please tick all that apply)				
	● Garage □				
	Allocated parking space				
	• Driveway				
	Shared parking				
	● On street				
	Resident permit				
	Metered parking				
	Other (please specify):				
4.	Conservation area				
	Is your property in a designated Conservation Area (that is an area of	Yes			
	special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?	No	\boxtimes		
	appearance of winding is desirable to preserve of emance):	Don't know			
5.	Listed buildings				
	Is your property a Listed Building, or contained within one	Vac			
	(that is a building recognised and approved as being of special architectural or historical interest)?	Yes No	\boxtimes		
6.	Alterations/additions/extensions				
a.	(i) During your time in the property, have you carried out any	Yes			
	structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No	\square		



	If you have answered yes, please describe below the changes which you have made:		
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work? If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	Yes No	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes No	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes No	
	(ii) Did this work involve any changes to the window or door openings?	Yes No	
	(iii) Please describe the changes made to the windows doors, or approximate dates when the work was completed): Please give any guarantees which you received for this work to ye estate agent.	,	1
7.	Central heating		
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom). If you have answered yes or partial – what kind of central	Yes No Partial	
	heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air). If you have answered yes, please answer the three questions below:	Gas-fired	
	i) When was your central heating system or partial central heating system installed?	2011 (Approx)	



	(ii) Do you have a maintenance contract for the central heating system?	Yes No	
	If you have answered yes, please give details of the company with which you have a maintenance contract:		
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).		
8.	Energy Performance Certificate		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes No	\boxtimes
9.	Issues that may have affected your property		
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes No	
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes No	
b.	Are you aware of the existence of asbestos in your property?	Yes	
	<u>If you have answered yes</u> , please give details:	No	



10.	Services				
a. Ple		e connected to your propert	y and give	details of the	
Suppli	ei.				
Servi	ces	Connected	Supplier		
Gaso	or liquid petroleum gas	Yes	SSE		
	r mains or private · supply	Yes	Council		
Elect	ricity	Yes	SSE		
Mains	s drainage	Yes	Council		
Telep	hone	No			
Cable	e TV or satellite	No			
Broad	dband	No			
b.	Is there a septic tank sys If you have answered yes below:	tem at your property? s, please answer the two que	stions	Yes No	
	(i) Do you have appropriate consents for the discharge from your septic tank?			Yes No Don't know	
		nance contract for your sept		Yes No	
	If you have answered yes, please give details of the company with which you have a maintenance contract:				
11.	Responsibilities for share	ed or common areas			
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?				
	If you have answered yes,	Screen Autum Maintenance	n		
b.	Is there a responsibility to the roof, common stairwell	contribute to repair and main or other common areas?	tenance of	Yes No	
	If you have answered yes, please give details:			Don't know Screen Autum Maintenance	n
C.	Has there been any major roof during the time you ha	repair or replacement of any pave owned the property?	art of the	Yes No	



d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?	Yes No	
	If you have answered yes, please give details:		
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	Yes No	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	Yes No	
	<u>If you have answered yes</u> , please give details:	Public Path	
12.	Charges associated with your property		
a.	Is there a factor or property manager for your property?	Yes	M
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	No Screen Autumi Elgin :£45/Mon	•
b.	Is there a common buildings insurance policy? If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes No Don't know Building Insura	⊠ □ ance
C.	Please give details of any other charges you have to pay on a regulupkeep of common areas or repair works, for example to a resident maintenance or stair fund.		
13.	Specialist works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes No	
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.		
	As far as you are aware, has any preventative work for dry rot, wet	Yes	
b.	rot, or damp ever been carried out to your property?	No	\boxtimes



c.	If you have answered yes to 13(a) or (b), deguarantees relating to this work? If you have answered yes, these guarantee purchaser and should be given to your soll possible for checking. If you do not have to solicitor or estate agent will arrange for the will also need to provide a description of to This may be shown in the original estimate Guarantees are held by:	r . You	Yes No			
14.	Guarantees					
a.	Are there any guarantees or warranties for	r any of tl	ne followi	ing:		
		No	Yes	Don't know	With title deeds	Lost
(i)	Electrical work			\boxtimes		
(ii)	Roofing			\boxtimes		
(iii)	Central heating			\boxtimes		
(iv)	National House Building Council (NHBC)			\boxtimes		
(v)	Damp course			\boxtimes		
b.	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy) If you have answered 'yes' or 'with title de installations to which the guarantee(s) relations.	⊠ details of	the work or			
C.	Are there any outstanding claims under an listed above? If you have answered yes, please give det		guarante	es	Yes No	
15.	Boundaries					
	So far as you are aware, has any boundary moved in the last 10 years? If you have answered yes, please give details.	been	Yes No Don't know			
16.	Notices that affect your property					
	In the past three years have you ever re					
a.	advising that the owner of a neighbouring application?	ng prope	rty has m	nade a	Yes No	
b.	that affects your property in some other	way?			Yes No	



c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes No	\square
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.		

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s): NOT REQUIRED

Date: 18/02/20



