

HARVEY DONALDSON & GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot







- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire



survey report on:

Property address	11A Tailwell, North Road, Forres, IV36 1BA
Customer	Ms K Pugh
Customer address	
Prepared by	Harvey Donaldson And Gibson
Date of inspection	6th June 2022



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.


Description	The property consists of a purpose built first floor flat in a two storey block of four flats.
Accommodation	First Floor: Hallway, Bedroom, Bathroom, Lounge, Kitchen.
Gross internal floor area (m²)	44
Neighbourhood and location	The property is situated within an established residential area on the north side of Forres town centre. Surrounding properties are of similar age and character. All main amenities are available nearby.
Age	57 years.
Weather	It was dry at the time of the inspection.
Chimney stacks	None.
Roofing including roof space	The roof is of the pitched, timber framed type, covered with concrete interlocking tiles.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Rainwater fittings are of the upvc. plastic type.

appropriate. Foundations and concealed parts were not exposed or inspected. The external walls are of Wimpey 'no fines' poured concrete construction, clad with external wall insulation with a roughcast finish. Wall thickness approximately 450 mm. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. External decorations Visually inspected. The external timbers are painted. Conservatories / porches None. Communal areas Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard.		
inspected. The external walls are of Wimpey 'no fines' poured concrete construction, clad with external wall insulation with a roughcast finish. Wall thickness approximately 450 mm. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. External decorations Visually inspected. The external timbers are painted. Conservatories / porches None. Communal areas Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Ceilings Visually inspected from floor level. Ceilings are plasterboard. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stainvell wall and party wall	Main walls	
construction, clad with external wall insulation with a roughcast finish. Wall thickness approximately 450 mm. Windows, external doors and joinery Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. External decorations Visually inspected. The external timbers are painted. Conservatories / porches None. Communal areas Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Ceilings Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		·
Reys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. External decorations Visually inspected. The external timbers are painted. Conservatories / porches None. Communal areas Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Ceilings Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stainwell wall and party wall		construction, clad with external wall insulation with a roughcast
Reys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. External decorations Visually inspected. The external timbers are painted. Conservatories / porches None. Communal areas Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Ceilings Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stainwell wall and party wall		
Doors and windows were not forced open. The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. Wisually inspected. The external timbers are painted. Conservatories / porches None. Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Ceilings Visually inspected from floor level. Ceilings are plasterboard. Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stainwell wall and party wall	Windows, external doors and joinery	•
The windows are of a double glazed upvc. plastic type. The flat door is timber. The fascia boards and soffits at the eaves of the roof are timber. Wisually inspected. The external timbers are painted. Conservatories / porches None. Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stainwell wall and party wall		Random windows were opened and closed where possible.
door is timber. The fascia boards and soffits at the eaves of the roof are timber. Visually inspected. The external timbers are painted. Conservatories / porches		Doors and windows were not forced open.
The external timbers are painted. Conservatories / porches None. Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door.		door is timber. The fascia boards and soffits at the eaves of the
The external timbers are painted. Conservatories / porches None. Circulation areas visually inspected. There is a shared entrance hallway and stainwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. There is a store off the landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door. Circulation areas visually inspected. The landing at the property external door.	External decorations	Visually inspected
Conservatories / porches Circulation areas visually inspected. There is a shared entrance hallway and stairwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	External decorations	, ·
Circulation areas visually inspected. There is a shared entrance hallway and stairwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		The external timbers are painted.
There is a shared entrance hallway and stairwell. At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Conservatories / porches	None.
At the front of the block there is a gravel / flower bed area, and at the rear there is a shared grassed drying green area. Garages and permanent outbuildings Visually inspected. There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Communal areas	Circulation areas visually inspected.
Ceilings Visually inspected. There is a store off the landing at the property external door. Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		There is a shared entrance hallway and stairwell.
There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		
There is a store off the landing at the property external door. Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Garages and permanent outbuildings	Visually inspected.
Outside areas and boundaries Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		
Ceilings Visually inspected from floor level. Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		There is a store on the landing at the property external door.
Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Outside areas and boundaries	
Ceilings are plasterboard. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Ceilings	Visually inspected from floor level
Internal walls Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		, ·
Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall		Genings are plasterboard.
dampness where considered appropriate. The internal walls are of timber studwork framed construction. The walls are lined with plasterboard. The stairwell wall and party wall	Internal walls	Visually inspected from floor level.
walls are lined with plasterboard. The stairwell wall and party wall		
		walls are lined with plasterboard. The stairwell wall and party wall

Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The floor appears to be of suspended concrete construction.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are mainly flush-faced hollow core units. The skirting boards and door surrounds are timber. The kitchen fittings consist of a range of floor and wall mounted units.
Chimney breasts and fireplaces	None.
Internal decorations	Visually inspected.
	The ceilings and walls are papered and painted. Internal joinery is painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains electricity is installed. The meter and consumer unit are located in the hall cupboard. The system appears to be of a modern 13 amp type and design. The switch and socket outlets
Gas	are plastic and the wiring is sheathed with PVC, where visible No gas.

Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is supplied from the mains. The supply pipe is copper where visible. The bathroom contains a bath with shower over, wash hand basin and WC.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	Heating is provided by electric night storage heaters and convectors. Hot water is provided by electric immersion heating.
Drainage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	The property is connected to mains drainage.
Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property has smoke detectors and a carbon monoxide detector.
	Scottish Government regulations came into effect on 01 February 2022, requiring each property to have linked smoke and heat detectors and, if gas / carbon burning appliances are present, a carbon monoxide alarm fitted. We understand that the property is compliant.
Any additional limits to inspection	It was dry at the time of the inspection. The property was occupied and fully furnished. The floors were covered with fixed coverings. The insulation at ceiling level restricted inspection of the ceiling and joists in the roof space. Inspection of the rear roof slope could only be undertaken at a distance.

Sectional Diagram showing elements of a typical house

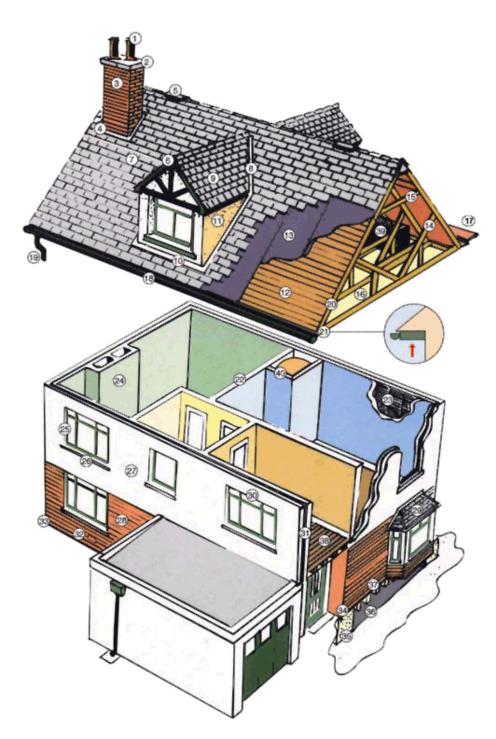

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6) Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- Dormer projection
- 10 Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- (16) Insulation
- 17) Parapet gutter
- (18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards /skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- (25) Window pointing
 - Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- 31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33 Damp proof course
- 34) Base course
- 35) Foundations
- (36) Solum
- 37) Floor joists
- 38) Floorboards
- 39) Water tank
- 40 Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.

Dampness, rot and infestation	
Repair category	1
Notes	No obvious significant dampness, timber decay or infestation noted, within the limitations imposed on the inspection.

Chimney stacks	
Repair category	-
Notes	Not applicable.

Roofing including roof space	
Repair category	1
Notes	No significant disrepair was noted to the roof or coverings, allowing for normal weathering consistent with age.
	Several loose fibreboard sarking sheets were noted in the roof space.
	Some moss growth was noted on the tiling.
	The manufacturers of concrete roof tiles expect that a roof tile will normally last for approximately 50 years. This should be taken into consideration having regard to the age of this property.

Rainwater fittings	
Repair category	1
Notes	No significant disrepair was noted to rainwater goods. It will however be appreciated that the inspection was carried out during dry weather conditions. Sometimes defects in rainwater goods are only apparent during, or after heavy rainfall.

Main walls	
Repair category	1
Notes	No obvious significant defects were noted to the accessible wall surfaces. Any documentation and guarantees regarding the insulation cladding should be obtained.

Windows, external doors and joinery	
Repair category	1
Notes	No obvious significant defects were noted to windows, doors or external joinery.

External decorations	
Repair category	1
Notes	No obvious significant defects noted.

Conservatories/porches	
Repair category	-
Notes	Not applicable.

Communal areas	
Repair category	1
Notes	No obvious significant defects were noted to communal areas, consistent with age and type.

Garages and permanent outbuildings	
Repair category	1
Notes	No obvious significant defects noted.

Outside areas and boundaries	
Repair category	-
Notes	

Ceilings	
Repair category	1
Notes	No obvious significant defects were noted to ceiling surfaces. The Artex finish may contain asbestos fibres, but this can only be determined by taking a sample for analysis. Even if the finish does contain asbestos fibres, it is not normally considered to be a health hazard provided it is not disturbed. If removal is contemplated, this should only be carried out by a licensed asbestos removal contractor.

Internal walls	
Repair category	1
Notes	No obvious significant defects were noted to walls and wall surfaces.

Floors including sub-floors	
Repair category	1
Notes	No obvious significant defects were noted to flooring, within the limitations imposed by fully fitted floor coverings.

Internal joinery and kitchen fittings	
Repair category	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings. It should be confirmed that the glass door has safety glass.

Chimney breasts and fireplaces	
Repair category	-
Notes	Not applicable.

Internal decorations	
Repair category	1
Notes	No obvious significant defects were noted to the internal decorations.

Cellars	
Repair category	-
Notes	Not applicable.

Electricity	
Repair category	2
Notes	No obvious significant defects noted, however there is no evidence that the system has been tested within the last ten years. The system should be checked by a qualified electrician and any necessary upgrading works carried out.

Gas	
Repair category	-
Notes	Not applicable.

F Water, plumbing and	d bathroom fittings
Repair category	1
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings.

Heating and hot wat	er
Repair category	1
Notes	The system was not running at the time of inspection but appeared serviceable. The hot water tank appeared serviceable.

Drainage	
Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	-
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	2
Gas	-
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	First floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes No X
3. Is there a lift to the main entrance door of the property?	Yes No X
4. Are all door openings greater than 750mm?	Yes No X
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be absolute ownership.

It is assumed that the there are no unusually onerous provisions in the title documents and that management/service charge agreements are not excessive. Full details should be obtained prior to purchase.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent conveyancing solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

Estimated reinstatement cost for insurance purposes

£130,000 (One hundred and thirty thousand pounds).

Building costs are currently increasing significantly above inflation due to material and labour shortages. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

Valuation and market comments

In its present condition our opinion of value of the Outright Ownership interest of the property with vacant possession on 06 June 2022 is £82,000 (eighty two thousand pounds).

Signed	Security Print Code [516782 = 5629]O Electronically signed					
Report author	Douglas J H Mowat, MRICS					
Company name	Harvey Donaldson And Gibson					
Address	Duncan House, Wester Inshes Place, Inverness, IV2 5HZ					
Date of report	10th June 2022					



Property Address	
Address Seller's Name Date of Inspection	11A Tailwell, North Road, Forres, IV36 1BA Ms K Pugh 6th June 2022
Property Details	
Property Type	☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette ☒ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use ☐ Other (specify in General Remarks)
Property Style	□ Detached □ Semi detached □ Mid terrace □ End terrace □ Back to back □ High rise block ▼ Low rise block □ Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	elieve that the property was built for the public sector, X Yes No nilitary, police?
Flats/Maisonettes onl	
Approximate Year of	
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 1 Bedroom(s) 1 Kitchen(s) 1 Bathroom(s) 0 WC(s) 0 Other (Specify in General remarks)
Gross Floor Area (ex	cluding garages and outbuildings) 4 m² (Internal) 54 m² (External)
Residential Element ((greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage Available on site?	 □ Double garage □ Yes □ No □ Parking space □ X No garage / garage space / parking space
Permanent outbuildin	igs:
No permanent outb	uildings.

Construction							
Walls	Brick	Stone	X Concrete	Timber frame	Other ((specify in Gen	eral Remarks)
Roof	X Tile	Slate	Asphalt	Felt	Other ((specify in Gen	eral Remarks)
Special Risks							
Has the property su	ffered structu	ıral movement	?			Yes	X No
If Yes, is this recent	or progressi	ve?				Yes	No
Is there evidence, h immediate vicinity?	istory, or rea	son to anticipa	te subsidence,	heave, landslip or	r flood in the	Yes	X No
If Yes to any of the	above, provid	de details in Ge	eneral Remark	S.			
Service Connecti	on						
Based on visual insof the supply in Ger			appear to be	non-mains, please	comment or	n the type ar	nd location
Drainage [X Mains	Private	None	Water	X Mains	Private	None
Electricity [X Mains	Private	None	Gas	Mains	Private	X None
Central Heating [X Yes [Partial	None				
Brief description of	Central Heati	ng:					
Heating fuel: Elect							
Heating type: Rad		ae					
3 71	,	,					
Site							
Apparent legal issue	es to be verif	ed by the conv	eyancer. Plea	se provide a brief	description in	General Re	emarks.
Rights of way	Shared drive	s / access	Garage or other	amenities on separate	site Share	ed service conn	ections
Ill-defined boundaries	3	Agricultura	l land included wit	h property	Other	(specify in Ger	neral Remarks)
Location							
Residential suburb	Resi	dential within town	/ city X Mixe	d residential / commerc	cial Mainly	y commercial	
Commuter village	Rem	ote village	Isola	ted rural property	Other	(specify in Ger	neral Remarks)
Planning Issues							
Has the property be	en extended	/ converted / a	ıltered? 🔲 Y	es X No			
If Yes provide detail	s in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly cor	mpleted new road	Pedestrian ac	cess only	Adopted	Unadopted

The property is situated within an established residential area on the north side of Forres town centre. Surrounding properties are of similar age and character. All main amenities are available nearby.
The external walls are of Wimpey 'no fines' poured concrete construction, clad with external wall insulation with a roughcast finish. Wall thickness approximately 450 mm.
The property is of non-traditional wall construction, although most lenders accept such properties. Clarification should be sought from the chosen Lending Institution that this property type meets their lending criteria.
The property appears to be in satisfactory condition for lending purposes.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended? Yes X No Amount £

Comment on Mortgagea	bility	
The property affords adeq lender's criteria. The property is of non-trace	juate security for loan purposes based on the valuation figure, and subject ditional wall construction, although most lenders accept such properties. Ce chosen lending institution that this property type meets their lending criteria.	Clarification
Valuations		
valuations		
Market value in present cor	ndition	£ 82,000
Market value on completion	of essential repairs	£
Insurance reinstatement va	lue rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£ 130,000
Is a reinspection necessary		Yes X No
	•	
Buy To Let Cases		
What is the reasonable rang month Short Assured Tenar	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No
Declaration		
Signed	Security Print Code [516782 = 5629]O	
Surveyor's name	Electronically signed by:- Douglas J H Mowat, MRICS	
Professional qualifications	MRICS	
Company name	Harvey Donaldson And Gibson	
Address	Duncan House, Wester Inshes Place, Inverness, IV2 5HZ	
Telephone	01463 718440	

Fax

Report date

0203 880 9193

10th June 2022

Energy Performance Certificate (EPC)

Dwellings

Scotland

11A TAILWELL, NORTH ROAD, FORRES, IV36 1BA

Dwelling type:Top-floor flatDate of assessment:06 June 2022Date of certificate:06 June 2022

Total floor area: 44 m²

Primary Energy Indicator: 360 kWh/m²/year

Reference number: 9012-9826-6100-0956-3206 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst


Main heating and fuel: Electric storage heaters

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,103	See your recommendations
Over 3 years you could save*	£582	report for more information

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

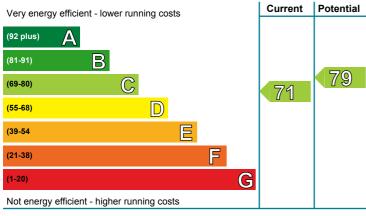


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

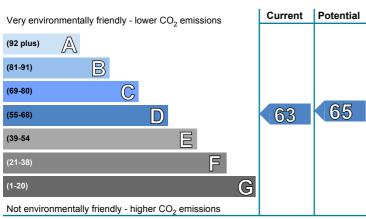

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (63)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 High heat retention storage heaters	£800 - £1,200	£582.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, with external insulation System built, as built, no insulation (assumed)	**** ***	**** ***
Roof	Pitched, 350 mm loft insulation	****	****
Floor	(another dwelling below)	_	_
Windows	Fully double glazed	★★★★ ☆	★★★★☆
Main heating	Electric storage heaters	***	****
Main heating controls	Automatic charge control	***	***
Secondary heating	Room heaters, electric	_	_
Hot water	Electric immersion, off-peak	****	***
Lighting	Low energy lighting in 83% of fixed outlets	****	****

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO_2 emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 61 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.2 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,059 over 3 years	£873 over 3 years	
Hot water	£888 over 3 years	£492 over 3 years	You could
Lighting	£156 over 3 years	£156 over 3 years	save £582
Tot	tals £2,103	£1,521	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.


Recommended measures		Typical saving		Rating after improvement		
K	ecommended measures	Indicative cost	per year	Energy	Environment	
1	High heat retention storage heaters and dual immersion cylinder	£800 - £1,200	£194	C 79	D 65	

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Cavity, internal or external wall insulation

Choosing the right improvement package





Recommendations Report

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 High heat retention storage heaters

Modern storage heaters have better insulation and are easier to control than the older type in this property. Ask for a quotation for new, high heat retention heaters with automatic charge and output controls. A dual-immersion cylinder, which can be installed at the same time, will provide cheaper hot water than the system currently installed. Installations should be in accordance with the current regulations covering electrical wiring. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,157	N/A	N/A	N/A
Water heating (kWh per year)	1,757			

Addendum

This dwelling is a system built property or some of its walls are of non-conventional construction and requires further investigation to establish the type of construction, the type of wall insulation best suited (cavity insulation or internal/external insulation) and the savings it might deliver. Please contact the Home Energy Scotland hotline on 0808 808 2282 to find out more.

Recommendations Report

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Douglas Mowat

Assessor membership number: EES/016092

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors

Address: Duncan House Wester Inshes Place

Highland Inverness IV2 5HZ 014637184

Phone number: 01463718440

Email address: frances.wilson@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greeners cotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Property Address	11A Tailwell, Forres, Moray, IV36 1BA
Vendor(s)	Miss Kayleigh Pugh
Completion Date of Property Questionnaire	
System Ref:	QT633307





Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1.	Length of ownership			
	How long have you owned the property? 2 years 7 months			
2.	Council Tax			
	Which Council Tax band is your property in?			
	A Ø B 😵 C 😵 D 😵 E 😵 F 😵 G	×	Н	X
3.	Parking			
	What are the arrangements for parking at your property? Please tick all that apply?			
	Garage 😵 💢 Allocated parking space 😵	Dr	iveway	×
	Shared parking ⊗ On street ✓ R	Resident	permit	×
	Metered parking 🔕 Other (please specify):			
4.	Conservation area			
	Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?		Yes No	
	,	Don'	t know	×
5.	Listed buildings			
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?		Yes No	
6.	Alterations/additions/extensions			
	During your time in the property, have you carried out any structural alterations, additions or		Yes	×
a.	extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?		No	
(i)	If you have answered yes, please describe below the changes which you have made:			
	Did you obtain planning permission, building warrant, completion certificate and other		Yes	×
(ii)	consents for this work?		No	×
(iv)	If you have answered yes, the relevant documents will be needed by the purchaser and you sh solicitor as soon as possible for checking. If you do not have the documents yourself, please not these documents and your solicitor or estate agent will arrange to obtain them:			your



6.	Alterations/additions/extensions	
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below	Yes 😵 No 🕢
(i)	Were the replacements the same shape and type as the ones you replaced?	Yes 😵
		No 😵
(ii)	Did the work involve any changes to the window or door openings?	Yes 😵 No 😵
(iii)	Please describe the changes made to the windows doors, or patio doors (with approximate dat completed): Please give any guarantees which you received for this work to your solicitor or estate agent	es when the work was
7.	Central heating	
/.	Is there a central heating system in your property?	
	(Note: a partial central heating system is one which does not heat all the main	Yes 🗸
a.	rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	No 😵
		Partial 😵
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air)	
	Electric Storage heating	
	If you have answered yes, please answer the three questions below	
(i)	When was your central heating system or partial central heating installed?	Unknown
	Do you have a maintenance contract for the central heating system?	Yes 😵
		No 🕢
(ii)	If you answered yes please give details of the company with whom you have a maintenance co	ontract
(iii)	When was your maintenance contract last renewed? (Please provide the month and year)	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less	Yes 🗸
	than 10 years old?	No ⊗
9.	Issues that may have affected your property	
	Has there been any storm, flood, fire, or other structural damage to your	Yes 😵
a.	property while you have owned it?	No 🕢
! 	If you have answered yes is the damage the subject of any outstanding	Yes 😵
	insurance claim?	No &
	Are you aware of the existence of asbestos in your property?	Yes &
b.	your property.	No 🐼
	Mary have an averaged year places about detailer	140
	If you have answered yes please give details:	
l		



10.	Services			
	Please tick which services are connected	ed to your property	and give details of	the supplier
	Service	Connected	Suppl	ier
	Gas or liquid petroleum gas	8		
	Water mains or private water supply		Moray Co	ouncil
a.	Electricity		BULE	3
	Mains drainage		Moray Co	ouncil
	Telephone		ВТ	
	Cable TV or satellite	8		
	Broadband		ВТ	
b.	Is there a septic tank at your property?			Yes 😵
D.	If you have answered yes please answ	wer the questions b	pelow	No 🕢
	Do you have appropriate consents for the	ne discharge of you	ur septic tank?	Yes 😵
(i)				No 😵
				Don't know 🚫
	Do you have a maintenance contract for	r your septic tank?		Yes 😵
/::\				No 😵
(ii)	If you answered yes please give details of the co	mpany with whom you	have a maintenance cor	ntract
11.	Responsibilities for shared or comme	on areas		
	Are you aware of any responsibility to contribute to the cost of anything			
	Are you aware of any responsibility to co used jointly, such as repair of a shared d			Yes 😣
				Yes No 🤡
a.	used jointly, such as repair of a shared			
a.	used jointly, such as repair of a shared			No 🕢
a.	used jointly, such as repair of a shared garden area? If you answered yes please give details	drive, private road,	boundary, or	No <u>✓</u> Don't know <u></u>
a.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to compare the same area.	drive, private road,	boundary, or	No 🕢
a.	used jointly, such as repair of a shared garden area? If you answered yes please give details	drive, private road,	boundary, or	No <u>✓</u> Don't know <u></u>
a. b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to compare the same area.	drive, private road,	boundary, or	No ♥ Don't know Yes ♥
	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to compare the same area.	drive, private road,	boundary, or	No ODON'T know S
	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes	drive, private road, ontribute to the cosvell, or other comm	st of repair and non areas?	No ⊘ Don't know ⊗ Yes ⊘ No ⊗
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl	ontribute to the cosvell, or other comm	st of repair and non areas?	No ⊘ Don't know ⊗ Yes ⊘ No ⊗
	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes	ontribute to the cosvell, or other comm	st of repair and non areas?	No ODON'T know S Yes No S Don't know S
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to commintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	ontribute to the cosvell, or other commacement of any palding?	st of repair and non areas?	No N
b. c.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to comaintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	ontribute to the cosvell, or other commacement of any palding?	st of repair and non areas?	No ODON'T know S Yes ODON'T know S Yes No No ODON'T know S
b.	used jointly, such as repair of a shared garden area? If you answered yes please give details Are you aware of any responsibility to commintenance of the roof, common stairs If you answered yes please give details Yes Has there been any major repair or repl during the time you have owned the buil	ontribute to the cosvell, or other commacement of any palding?	st of repair and non areas?	No ODON'T know S Yes No ODON'T know S Yes No Ves No Ves S



11.	Responsibilities for shared or common areas						
	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin, or to maintain their boundaries?	Yes 😵					
	property, for example to put out their rubbish biri, or to maintain their boundaries?	No 🤡					
e.	If you answered yes please give details						
	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately owned.)	Yes 😵					
f.		No 🔗					
	<u>If you answered yes</u> please give details						
12.	Charges associated with your property						
12.	Is there a factor or property manager for your property?	Yes 😵					
	is there a factor or property manager for your property:	Yes No 🕢					
a.	If you answered yes please provide name and address and give details relating to deposits held						
	please provide name and address and give details relating to deposits field and charges						
	Is there a common buildings insurance policy?	Yes 😣					
	go monera, pons,	No 🐼					
b.		Don't know 🔕					
	If you answered yes is the cost of insurance included in your monthly/annual factor's charges?	Yes					
		No					
	Please give details of any other charges you have to pay on a regular basis for the up						
C.	areas or repair works, for example to a residents' association, or maintenance or stair None	Tuna.					
13.	Specialist works						
	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes 😵					
		No 🔗					
	If you answered yes please give further details						
a.							
	Do you have any guarantees for this work?	Yes 🔕					
	Consented and health have	No 🔉					
	Guarantees are held by :						
	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	Yes 🔕 No 🕢					
	If you areward was placed give further details	INO W					
h	If you answered yes please give further details b.						
ν.	Do you have any guarantees for this work?	Yes 😵					
		No 🐼					
	Guarantees are held by :						



14.	Guarantees					
	Are there any warranties or guarantees for any of the following					
a.		No	Yes	Don't know	With title deeds	Lost
(i) b.	Electrical work	Ø	8	8	8	8
(ii) b.	Roofing	Ø	8	8	8	8
(iii) b.	Central heating	Ø	8	8	8	8
(iv) b.	National House Building Council (NHBC)	8	8	Ø	8	8
(v) b.	Damp course	Ø	8	8	8	8
(vi)	Any other work or installation? (for example cavity wall insulation, underpinning, indemnity policy)				×	×
b.		ı				
	Are there any outstanding claims under any of the guarantees listed above?			Yes ⊗ No ⊗		
C.	<u>If you answered yes</u> please give details					
15.	Boundaries					
a.	Are you aware has any boundary of your property been moved in the last ten years?			Yes 😵 No 🕜		
	<u>If you answered yes</u> please give details			Do	on't kno	ow 😵



16.	Notices that affect your property	
	In the past three years have you ever receievd a notice :	
a.	Advising that the owner of a neighbouring property has made a planning application?	Yes ♥ No ⊗
b.	that affects your property in some other way?	Yes No 🥥
c.	that requires you to perform any maintenance, repairs, or improvements to the property?	Yes No 🕢
	If you answered yes to any of a-c above please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property	

Declaration by the seller(s) or other authorised body or person(s)

I/We confirm that the information on this form is true and correct to the best of my/our knowledge and belief.

Signatures:

Kayleigh Pugh

Date:



